

Repair Lines - High Priority

Line Type NOT IN ('Management Action Point', 'Aviation Route', 'Aerial Hazard', 'Completed Burnout', 'Escape Route', 'Fire Edge (Field Collection)', 'Foil Drop', 'Highlighted Feature', 'Other', 'Planned Burnout', 'Planned Dozer Line', 'Planned Fuel Break', 'Planned Hand Line', 'Planned Mixed Construction Line', 'Planned Plow Line', 'Planned Road as Line', 'Planned Secondary Line', 'Retardant Drop', 'Temporary Flight Restriction', 'UAS Launch and Recovery Zone', 'Water Drop', 'Access or Improved Road', 'Completed Road as Line')
 Repair Status NOT IN ('In Use - Fire Management', 'No Repair Needed')
 Repair Priority = 'High'
 FeatureStatus = 'Approved'
 IsVisible = 'Yes'
 DeleteThis = 'No'

GISS Misc	Line Type	Repair Status	Repairs Needed	Repair Comments
1001	Completed Dozer Line	Repair Needed	Stabilization done. Water bars could be improved. REAF Olin 8/22 Pull back berms, scatter slash, and provide erosion control. REAF CM 01Aug	
1002	Completed Hand Line	Repair Needed	Full repair	Disguise entrances, cover in slash, waterbar and pull in berms (SIJ 07/01)
1364	Completed Dozer Line	Repair Needed	Partial repair	Pull in berms, add waterbars, cover in slash, seed. Pull back dozer pushes and cover with slash. (REAF Johannsen)
1007	Completed Dozer Line	Repair Needed	water bars in steep sections, pull in berm	
1008	Completed Hand Line	Completed - Inspected	Full repair	Disguise entrance, cover in slash, pull in berms
1009	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, disguise entrances, cover in slash.
1010	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, scatter slash, disguise entrances, waterbar where needed
1011	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, cover in slash, disguise entrances (REAF Johannsen)
1012	Completed Dozer Line	Repair Needed	Full Repair, block all access from road to prevent OHV use pull in berm, water bars in steep sections	
1013	Completed Hand Line	Completed - Inspected	Partial	Rec REAF should be present during repair. Trail widened to use as line, pull in berms and return to trail width
1014	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms and disguise entrance, cover in slash.
1015	Completed Dozer Line	Repair Needed	Partial repair	Pull in berms, add waterbars, cover in slash, seed. Pull back dozer pushes and cover with slash. (REAF Johannsen)
1365	Completed Hand Line	Completed - Inspected	Full repair	Rec REAF should be present during repair. Small section is trail used as line, no repair needed. For the remaining portion: Add water bars, pull in berms, disguise entrances, cover in slash (REAF Johannsen)
1017	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, cover in slash, disguise entrances (REAF Johannsen)
1366	Completed Dozer Line	Repair Needed	Pull in berms, pull in slash as available, provide erosion control. Consider seeding grass areas. REAF CM 01Aug. Light Repair	LIGHT REPAIR. Need to block entrance. Also pull berms and slash. Excavator or dozer. REAF Olin 8/22 Interim stabilization complete (water bars only) - 8/14 REAF KC. steep section near south end may not be workable per task force leader, remainder needs type 2 excavator with thumb and blade REAF Merten 8/24
1029	Completed Hand Line	Repair Needed	Excavator can continue from dozer line. Pull berms and slash. Make water bars. REAF Olin 8/22	
1030	Completed Dozer Line	Repair Needed	full repair	pull in slash and berms, provide erosion control. consider using felled trees across slope as waterbars. Excavator work. Pull berms and slash. Make water bars. REAF Olin 8/22
1031	Completed Dozer Line	Repair Needed	Light Repair	Pull in berms, water bar, cover with slash, and block entrances 7/31 REAF KC. Interim stabilization complete (water bar only) REAF KC. Cheatgrass present at start of dozer line by DP45, needs seed and mulch to prevent spread of invasives. BM 8/23 Arch Cleared LL 8/23
1033	Completed Dozer Line	Repair Needed	Light repair	Knock down berms, scatter light veg, recontour/add waterbars, block entrances, seed (SIJ 07/30), cleared for arch by DS 8.6.23. Interim stabilization (water bar only) complete 8/18 REAF KC. still plumbed 8/22
1038	Completed Hand Line	Completed - Inspected	Scatter slash as available	No slash to bill back no scrape. 8/22/23: no hand line constructed, only file break. No repair needed.
1372	Completed Dozer Line	Needs Assessment	Full Repair	Pull in berms, water bar, and cover with slash 7/31 REAF KC. Interim repair complete (water bars only) 8/17 REAF KC. note narrow width for excavator 8/24 EM .Arch cleared LL 8/24
1374	Completed Dozer Line	Repair Needed	Repair Light	Pull in berms, recontour, cover with light vegetation, block entrances (SIJ 07/30)
1060	Completed Dozer Line	Repair Needed	Full repair.	pull in berms and add waterbars as needed, close off entrance. Arch LL 8/23 REAF Jackson 7/25/23
1375	Completed Dozer Line	Repair Needed	pull in berms, install waterbars as needed, place slash on steep sections, disguise entry points. clean dirt out of road ditch on north end, use coconut matting with stakes to stabilize lower end	REAF Jackson 7/25/23
1063	Completed Dozer Line	Repair Needed	Full Repair	Add water bars for interim use then light repair as follows (MDS 8/6/23): Add waterbars/recontour, knock down berms, scatter with light slash, block entrances, seed (SIJ 07/30) cleared for arch by DS 8.6.23. Interim stabilization complete (water bars only) 8/18 REAF KC.
1070	Completed Dozer Line	Repair Needed	Interim repair then Light repair	For interim fire use install water bars during suppression repair, repairs as follows (MDS 8/6/23): Block entrances, recontour/add waterbars, seed and cover with light slash (SIJ 07/25) berms not pulled, not much slash available, seed and mulch to prevent erosion and use. BM 8/22
1072	Completed Hand Line	Repair Needed	Pull berm and slash	
1076	Completed Hand Line	Repair Needed		
1080	Completed Hand Line	Completed - Inspected	Full Repair	Pull back berms, bring to contour with slope, and cover with slash. 08/09 REAF KC
1081	Completed Hand Line	Repair Needed		
1082	Completed Hand Line	Repair Needed		
1083	Completed Dozer Line	Repair Needed		

GISS Misc	Line Type	Repair Status	Repairs Needed	Repair Comments
1086	Completed Dozer Line	Repair Needed	Light Repair for Interim Management - Full repair needed during suppression repair	IF interim repair is performed water bar steep section in trees. Dozer SHALL be weedwashed prior to entering this area. Prefer water bars to be installed by hand crew, area is very steep. Full repair comments follow (MDS 8/5/23): Bottom 200 yards dozed through grassy Oak savannah. REAF must be present for repair (SIJ 07/31)
1093	Completed Dozer Line	Repair Needed	Full repair	See repair plan specs (REAF DA 8/25) back berms with light slash and erosion control. REAF CM 01 Aug. Interim stabilization complete (water bars only) 8/18 REAF KC. cleared for arch by DS 8.6.23 .
1099	Completed Hand Line	Repair Needed	Full Repair	Pull in berms, bring to grade, mitigate erosion, and cover with slash where available. 08/05 - REAF KC
1376	Completed Hand Line	Repair Needed	Full repair	Pull in berms, disguise entrance, seed (SIJ 07/30). Interim stabilization (water bars only) complete 8/18 REAF KC.
1112	Completed Dozer Line	Repair Needed	Repair light - Meadow	Pull in berms and dozer pushes, cover in light slash, recontour and decompact, middle portion may be too steep for excavator, use handcrew (SIJ 07/31). Interim stabilization (water bars only) complete 8/18 REAF KC.
1113	Completed Dozer Line	Repair Needed	Partial repair	Bottom of dozer line goes into private land. Pull in berms and dozer pushes, cover in light slash, decompact and recontour (SIJ 07/30)
1114	Completed Dozer Line	Repair Needed	Light repair	Pull in berms and dozer pushes, cover in light slash, recontour, and decompact (SIJ 07/31)
1115	Completed Hand Line	Completed - Inspected	Full repair	Waterbar steep sections, Pull in slash and vegetation where available (SIJ 07/31)
1116	Completed Dozer Line	Repair Needed	Partial repair	Water bars done in stabilization. REAF Olin 8/22 Pull in berms and dozer pushes, block entrance, water bar, seed grassy areas. Upper flat portion will need to have water bars removed (SIJ 07/30)
1117	Completed Dozer Line	In Progress	Full Repair	Pull in berms, cover with slash as available, and control erosion 7/30 REAF KC. Interim stabilization complete (water bars only) 8/16 REAF KC.
1380	Completed Hand Line	Completed - Inspected	Full repair	Disguise entrances, cover in slash, waterbar and pull in berms (SIJ 07/01)
1381	Completed Hand Line	Completed - Inspected	repair light	handcrew, waterbar, pull in berm
1157	Completed Dozer Line	Needs Assessment	Dozer line is entirely on private land. two stream crossings	Pull in berms, mitigate erosion (water bars, clear ditch), cover with slash or chip slash, and block entrance. 08/02 - REAF - KC
1166	Completed Dozer Line	Completed - Inspected		Low priority to come back and improve water bars - many of them are at a perpendicular angle and need more outslipping. send equipment back for these needs only after line repair is completed in the rest of the division/area. KJH 8/13/23.
	Completed Dozer Line	Repair Needed	Light repair. Pull down dozer berms (minimal). Scatter vegetation across line. Fix some water bars (in place during stabilization phase). Block where line intersects roads.	READ Donnermeyer 08/27/2023 - Arch monitor for section SE of 050 road down to Pistol River.
1201	Completed Dozer Line	Repair Needed	Full repair. Logged furl break corridor. Repair existing water bars. Most of line has light, well distributed logging slash across it. Block access on ends. Recommend medium excavator. REAF Webster 8/25/23	READ Donnermeyer 08/27/2024. Wattles/water bars potentially needed
1205	Completed Dozer Line	Repair Needed	Light repair	Arch REAF monitor during repair -Legnini cleared 8/26. Pull in berms, light slash and water bars; block access at road intersections to prevent OHV use. Mulch and seed within 200 feet of road. REAF Martin 8/25 - AA direction
1206	Completed Dozer Line	Repair Needed	Light Repair	pull in berms, light slash and water bars; block access at road intersections to prevent OHV use. Mulch and seed within 200 feet of road. REAF Martin 8/25 - AA direction
1208	Completed Dozer Line	Repair Needed	Light repair	Pull in berms, add waterbars, scatter slash REAF Martin 8/25
1218	Completed Dozer Line	Repair Needed	Light repair and Full repair	1-3 blade widths. KJH 8/16/23. changed status per Div T 8/25 Pull in berms reduce dozerline size to one blade width with heavy slash and do light slash on the other half of dozerline. add waterbars, scatter slash, seed. REAF BM 8/24
1219	Completed Dozer Line	Completed - Inspected	Light repair. Water bar, scatter vegetation over line, small berms pulled in.	Cover line with vegetation. Block access with existing rocks and logs at intersection of 1503 Rd. Repair with excavator.
1220	Completed Hand Line	Completed - Inspected	Cover line vegetation that is available. Pull berms down.	
1221	Completed Dozer Line	Completed - Inspected	Light repair. Repair old, existing water bars and block access with existing logs and rocks at 1503 Rd. intersection. REAF Webster	
1223	Completed Dozer Line	In Progress	Full Repair. Standard per repair plan	Water bars, pull berms, disperse vegetation , mask ingress/ egress
1225	Completed Dozer Line	Repair Needed	Full Repair	Could use better water bars and slash pulled in. REAF Olin 8/22 Pull in berms, water bar, cover with slash, and block entrance. 8/16 REAF KC. Interim stabilization complete (water bar only) 8/18 REAF KC.
1359	Completed Hand Line	Repair Needed		Scatter slash
1388	Completed Dozer Line	Repair Needed	Light repair. Pull down dozer berms (minimal). Scatter vegetation across line. Fix some water bars (in place during stabilization phase). Block where line intersects roads.	READ Donnermeyer 08/27/2023