

Repair Lines - High Priority

Line Type NOT IN ('Management Action Point', 'Aviation Route', 'Aerial Hazard', 'Completed Burnout', 'Escape Route', 'Fire Edge (Field Collection)', 'Foil Drop', 'Highlighted Feature', 'Other', 'Planned Burnout', 'Planned Dozer Line', 'Planned Fuel Break', 'Planned Hand Line', 'Planned Mixed Construction Line', 'Planned Plow Line', 'Planned Road as Line', 'Planned Secondary Line', 'Retardant Drop', 'Temporary Flight Restriction', 'UAS Launch and Recovery Zone', 'Water Drop', 'Access or Improved Road', 'Completed Road as Line')
 Repair Status NOT IN ('In Use - Fire Management', 'No Repair Needed')
 Repair Priority = 'High'
 FeatureStatus = 'Approved'
 IsVisible = 'Yes'
 DeleteThis = 'No'

GISS Misc	Line Type	Repair Status	Repairs Needed	Repair Comments
1001	Completed Dozer Line	Repair Needed	Stabilization done. Water bars could be improved. REAF Olin 8/22 Pull back berms, scatter slash, and provide erosion control. REAF CM 01Aug. ARCH Donnermeyer 08/29/2023.	
1002	Completed Hand Line	Repair Needed	Full repair	Disguise entrances, cover in slash, waterbar and pull in berms (SIJ 07/01) vs. ARCH Donnermeyer 08/29/2023
1364	Completed Dozer Line	Completed - Inspected	Partial repair	Pull in berms, add waterbars, cover in slash, seed. Pull back dozer pushes and cover with slash. (REAF Johannsen)
1007	Completed Dozer Line	Repair Needed	water bars in steep sections, pull in berm	ARCH Donnermeyer 08/30/2024
1008	Completed Hand Line	Completed - Inspected	Full repair	Disguise entrance, cover in slash, pull in berms
1009	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, disguise entrances, cover in slash.
1010	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, scatter slash, disguise entrances, waterbar where needed
1011	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, cover in slash, disguise entrances (REAF Johannsen)
1012	Completed Dozer Line	Repair Needed	Full Repair, block all access from road to prevent OHV use pull in berm, water bars in steep sections	ARCH Donnermeyer 08/30/2024
1013	Completed Hand Line	Completed - Inspected	Partial	Rec REAF should be present during repair. Trail widened to use as line, pull in berms and return to trail width.
1014	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms and disguise entrance, cover in slash.
1015	Completed Dozer Line	Completed - Inspected	Partial repair	Pull in berms, add waterbars, cover in slash, seed. Pull back dozer pushes and cover with slash. (REAF Johannsen)
1365	Completed Hand Line	Completed - Inspected	Full repair	Rec REAF should be present during repair. Small section is trail used as line, no repair needed. For the remaining portion: Add water bars, pull in berms, disguise entrances, cover in slash (REAF Johannsen)
1017	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, cover in slash, disguise entrances (REAF Johannsen)
1023	Completed Dozer Line	Completed - Inspected	Partial repair	Add water bars/recontour, scatter light veg, knock down berms, disguise and block entrances, seed (SIJ 07/30), cleared for arch by DS 8.6.23. Interim stabilization complete (water bars only) 8/18 REAF KC.
1024	Completed Dozer Line	Completed - Inspected	Have hand crew spread slash in steep section. Coco mat by 2308 road. Seed and mulch 200 feet on 2308 section.	Clear material from road ditch above culvert. Not much available slash, consider coconut matting to stabilize dozer line above culvert. BM 8/23 Add water bars/recontour, scatter light veg, knock down berms, disguise and block entrances, seed (SIJ 07/30), cleared for arch by DS 8.6.23. Interim stabilization complete (water bars only) 8/18 REAF KC. Ready For Inspection 9/02 JB
1025	Completed Dozer Line	Repair Needed	Full Repair	Add waterbars by hand crew. Slash already scattered. Invasives present on 3318, seed heavily to prevent spread. REAF Martin 8/28
1366	Completed Dozer Line	Completed - Inspected	Pull in berms, pull in slash as available, provide erosion control. Consider seeding grass areas. REAF CM 01Aug. Light Repair	LIGHT REPAIR. Need to block entrance. Also pull berms and slash. Excavator or dozer. REAF Olin 8/22 Interim stabilization completed (water bars only) - 8/14 REAF KC. steep section near south end may not be workable per task force leader, remainder needs type 2 excavator with thumb and blade REAF Merten 8/24
1368	Completed Dozer Line	Repair Needed	Full repair	pull in slash and berms, add waterbars. excavator work. not much available slash, seed and mulch steep sections. on either side of stream use coconut matting, consult READ. READ Martin 9/2
1029	Completed Hand Line	Repair Needed	Arch cleared 8/22 LL. Excavator can continue from dozer line. Pull berms and slash. Make water bars. REAF Olin 8/22	
1030	Completed Dozer Line	Repair Needed	full repair	REAF Lang 9/2/23 Pull in berms, add water bars, not much available slash so use straw/mulch and seed. On either side of stream use coco matting
1031	Completed Dozer Line	Repair Needed	Light Repair	Pull in berms, water bar, cover with slash, and block entrances 7/31 REAF KC. Interim stabilization complete (water bar only) REAF KC. Cheatgrass present at start of dozer line by DP45, needs seed and mulch to prevent spread of invasives. BM 8/23 Arch Cleared LL 8/23
1033	Completed Dozer Line	Completed - Inspected	Seed top section to the tree line. Light repair. Hose lay Backhauled on 8/30. DIV F	Knock down berms, scatter light veg, recontour/add waterbars, block entrances, seed (SIJ 07/30), cleared for arch by DS 8.6.23. Interim stabilization (water bar only) complete 8/18 REAF KC. still plumbed 8/22. Ready For Inspection 9/02 JB
1038	Completed Hand Line	Completed - Inspected	Scatter slash as available	No slash to bill back no scrape. 8/22/23: no hand line constructed, only file break. No repair needed.
1385	Completed Dozer Line	Completed - Ready for Inspection	Light repair	READ Donnermeyer 08/23/2023
1371	Completed Dozer Line	Completed - Inspected	No seed or much needed. Full repair. Completed by hand crew on 8/24/23	READ Donnermeyer 08/23/2023
1372	Completed Dozer Line	Completed - Inspected	Full Repair	Pull in berms, water bar, and cover with slash 7/31 REAF KC. Interim repair complete (water bars only) 8/17 REAF KC. note narrow width for excavator 8/24 EM. Arch cleared LL 8/24
1373	Completed Dozer Line	Completed - Inspected	Full Repair	Could use more repair. Water bars look good. Interim stabilization complete (water bars only) 8/16 REAF KC.
1060	Completed Dozer Line	Completed - Inspected	Full repair.	pull in berms and add waterbars as needed, close off entrance. Arch LL 8/23 REAF Jackson 7/25/23
1375	Completed Dozer Line	In Progress	pull in berms, install waterbars as needed, place slash on steep sections, disguise entry points. clean dirt out of road ditch on north end, use coconut matting with stakes to stabilize lower end	REAF Jackson 7/25/23
1063	Completed Dozer Line	Repair Needed	Full Repair	Add water bars for interim use then light repair as follows (MDS 8/6/23): Add waterbars/recontour, knock down berms, scatter with light slash, block entrances, seed (SIJ 07/30) cleared for arch by DS 8.6.23. Interim stabilization complete (water bars only) 8/18 REAF KC.
1070	Completed Dozer Line	Repair Needed	Interim repair then Light repair	For interim fire use install water bars during suppression repair, repairs as follows (MDS 8/6/23): Block entrances, recontour/add waterbars, seed and cover with light slash (SIJ 07/25) berms not pulled, not much slash available, seed and mulch to prevent erosion and use. BM 8/22
1072	Completed Hand Line	Repair Needed	Pull berm and slash. ARCH Donnermeyer 08/30/2023.	
1076	Completed Hand Line	Repair Needed		
1080	Completed Hand Line	Completed - Inspected	Full Repair	ARCH Donnermeyer 08/30/2023. Pull back berms, bring to conto ur with slope, and cover with slash. 08/09 REAF KC. AzrCH
1081	Completed Hand Line	Repair Needed	Scatter brush . Arch cleared 8/30 Legnini	
1083	Completed Dozer Line	Repair Needed		
1086	Completed Dozer Line	Completed - Ready for Inspection	Light Repair for Interim Management - Full repair needed during suppression repair	Consider using UTV to bring bales of mulch to this line. Seed. Dozer SHALL be weedwashed prior to entering this area. Bottom 200 yards dozed through grassy Oak savannah. REAF must be present for repair. (SIJ 07/31) Do standard full repair as well as seed and mulch, especially in the oak savanna areas at top and bottom. REAF Martin 8/31.
1089	Completed Hand Line	Repair Needed	Hand line rehabbed, still needs to be seeded	Seed later in season. No mulch.
1090	Completed Hand Line	Repair Needed	Hand line rehabbed, still needs to be seeded	Seed later in season. No mulch.
1091	Completed Hand Line	Repair Needed	Hand line rehabbed, still needs to be seeded	Seed later in season. No mulch.
1092	Completed Hand Line	Repair Needed	Hand line rehabbed, still needs to be seeded	Seed later in season. No mulch.
1093	Completed Dozer Line	In Progress	Full repair	See repair plan specs (REAF DA 8/25) back berms with light slash and erosion control. REAF CM 01 Aug. Interim stabilization complete (water bars only) 8/18 REAF K C. cleared for arch by DS 8.6.23.
1100	Completed Dozer Line	Repair Needed	Full repair. Block access at intersection of 020 Rd. and 200 Rd. Pull back berms. Water bars and seed. Limited availability of slash	cleared for arch by DS 8.5.23
1376	Completed Hand Line	Completed - Inspected	Full repair	Pull in berms, disguise entrance, seed (SIJ 07/30). Interim stabilization (water bars only) complete 8/18 REAF KC.

GISS Misc	Line Type	Repair Status	Repairs Needed	Repair Comments
1112	Completed Dozer Line	Completed - Inspected	Repair light - Meadow	Pull in berms and dozer pushes, cover in light slash, recontour and decompact, middle portion may be too steep for excavator, use handcrew (SIJ 07/31). Interim stabilization (water bars only) complete 8/18 REAF KC.
1113	Completed Dozer Line	Completed - Inspected	Partial repair	Bottom of dozer line goes into private land. Pull in berms and dozer pushes, cover in light slash, decompact and recontour (SIJ 07/30)
1114	Completed Dozer Line	Completed - Inspected	Light repair	Pull in berms and dozer pushes, cover in light slash, recontour, and decompact (SIJ 07/31)
1115	Completed Hand Line	Completed - Inspected	Full repair	Waterbar steep sections, Pull in slash and vegetation where available (SIJ 07/31)
1116	Completed Dozer Line	Completed - Inspected	Partial repair	Water bars done in stabilization. REAF Olin 8/22 Pull in berms and dozer pushes, block entrance, water bar, seed grassy areas. Upper flat portion will need to have water bars removed (SIJ 07/30)
1117	Completed Dozer Line	Completed - Inspected	Full Repair	Pull in berms, cover with slash as available, and control erosion 7/30 REAF KC. Interim stabilization complete (water bars only) 8/16 REAF KC.
1378	Completed Dozer Line	In Progress	Full repair	Interim stabilization completed (water bars only). 8/14 REAF KC.
1379	Completed Dozer Line	Completed - Inspected	Full Repair	Seed and mulch down to where the line is mostly covered in veg/slash. Waterbars, pull in berms and dozer pushes, block entrance, seed (SIJ 08/01). Interim stabilization (water bars only) complete 8/18 REAF KC. water bars were install perpendicular to the line, NOT at a 45 degree.at want to reshape. 8/24 DIV F
1380	Completed Hand Line	Completed - Inspected	Full repair	Disguise entrances, cover in slash, waterbar and pull in berms (SIJ 07/01)
1381	Completed Hand Line	Completed - Inspected	repair light	handcrew, waterbar, pull in berm
1157	Completed Dozer Line	Needs Assessment	Dozer line is entirely on private land. two stream crossings	Pull in berms, mitigate erosion (water bars, clear ditch), cover with slash or chip slash, and block entrance. 08/02 - REAF - KC
1165	Completed Dozer Line	Completed - Inspected	Seed only	Light Repair - water bar for interim management, prior to closure as defined by the GBRD MDS 8/5/23
1166	Completed Dozer Line	Completed - Inspected	Seed only	Low priority to come back and improve water bars - many of them are at a perpendicular angle and need more outslping. send equipment back for these needs only after line repair is completed in the rest of the division/area. KJH 8/13/23.
1167	Completed Dozer Line	Completed - Inspected	Seed only	Light Repair - water bar for interim management, prior to closure as defined by the GBRD MDS 8/5/23
1187	Completed Dozer Line	Completed - Inspected	Light Repair on preexisting line, block access to OHVs and light slash placement needed	Interim repair (water bars only) completed. 08/16 REAF KC. Invasive cheat grass in area, seed especially/sections close to roads. READ Martin 8/29 ARCH DONNERMEYER cleared 8/29
1188	Completed Dozer Line	Completed - Inspected	Full Repair	Pull in berms, water bar, cover with slash, and block entrance. Excavator preferred. 8/12 REAF KC. Interim repair completed (water bar only) 8/15 REAF KC. 8/29 REAF Cardarella update: arch cleared, water bars look good. knock down pushes. not much slash so could use some reseed potentially, first half before the DZL split is the road.
	Completed Dozer Line	Completed - Inspected	Light repair. Pull down dozer berms (minimal). Scatter vegetation across line. Fix some water bars (in place during stabilization phase). Block where line intersects roads.	Inspector REAF Webster, 09/12/23. READ Donnermeyer 08/27/2023 - Arch monitor for section SE of 050 road down to Pistol River.
R350-4	Completed Dozer Line	Completed - Inspected	Needs berm knocked and slash scattered where applicable. Water bars installed where needed. Road is closed to public and needs access blocked. Direction came from Tim Merten the road engineer. REAF Olin 8/31	Close off entrance. Pull in berms, install waterbars where appropriate, especially near draws where seasonal streams are present but no culvert exists. seed in sections on road where native soil exists and near invasives. BRSY in road prism. UAR9 all along, some groups of CYS4. BM 8/23 Arch LL cleared 8/23
1201	Completed Dozer Line	Completed - Inspected	Full repair. Logged fuel break corridor. Repair existing water bars. Most of line has light, well distributed logging slash across it. Block access on ends. Recommend medium excavator. Recommend seeding dozer line and ends. REAF Webster	Inspector REAF Webster, 09/02/2023. // READ Donnermeyer 08/27/2024. Wattles/water bars potentially needed
1205	Completed Dozer Line	Completed - Ready for Inspection	Light repair	ARCH monitor repair complete 9/9 Cardarella. Pull in berms, light slash and water bars; block access at road intersections to prevent OHV use. Mulch and seed within 200 feet of road. REAF Martin 8/25 - AA direction
1206	Completed Dozer Line	In Progress	Light Repair	pull in berms, light slash and water bars; block access at road intersections to prevent OHV use. Mulch and seed within 200 feet of road. REAF Martin 8/25 - AA direction
1207	Completed Hand Line	Completed - Inspected	Full Repair - ARCH to monitor repair of hand line	READ Donnermeyer - 08/26/2023
1208	Completed Dozer Line	Completed - Ready for Inspection	Light repair	Pull in berms, add waterbars, scatter slash REAF Martin 8/25
1214	Completed Dozer Line	Completed - Inspected	Full repair. Water bar, pull in berms and fix push spot	REAF Webster 08/24/23
1218	Completed Dozer Line	Completed - Inspected	Light repair and Full repair	1-3 blade widths. KJH 8/16/23. changed status per Div T 8/25 Pull in berms reduce dozerline size to one blade width with heavy slash and do light slash on the other half of dozerline. add waterbars, scatter slash, seed. REAF BM 8/24. 9/03 ARCH CARDARELLA cleared.
1219	Completed Dozer Line	Completed - Inspected	Light repair. Water bar, scatter vegetation over line, small berms pulled in.	Cover line with vegetation. Block access with existing rocks and logs at intersection of 1503 Rd. Repair with excavator.
1220	Completed Hand Line	Completed - Inspected	Cover line vegetation that is available. Pull berms down.	
1221	Completed Dozer Line	Completed - Inspected	Light repair. Repair old, existing water bars and block access with existing logs and rocks at 1503 Rd. intersection. REAF Webster	
1223	Completed Dozer Line	Completed - Inspected	Full Repair. Standard per repair plan	Inspector REAF Webster, 09/01/2023. Water bars, pull berms, disperse vegetation , mask ingress/egress
1225	Completed Dozer Line	Completed - Inspected	Full Repair	Completed/inspected REAF Iodko 9/7/23. Could use better water bars and slash pulled in. REAF Olin 8/22 Pull in berms, water bar, cover with slash, and block entrance. 8/16 REAF KC. Interim stabilization complete (water bar only) 8/18 REAF KC. ARCH Donnermeyer 08/29/2023.
1227	Completed Dozer Line	Repair Needed	full repair	Pull in berms, spread slash where available, provide erosion control. Consider using felled trees instead of water bars on steep sections. Soils are highly erodible REAF CM 31Jul Interim stabilization complete (water bars only) 8/16 REAF KC. Water bars adequate, could bring in handcrew to pull in berms and scatter slash. cleared for Arch LL 8/23
1384	Completed Hand Line	Completed - Inspected	Repair with hand crew. Water bar to spec, pull berms, pull in slash- see repair plan for specs by READ Donnermeyer Arch cleared 08/27/2023	
1359	Completed Hand Line	Completed - Inspected		Scatter slash
1387	Completed Hand Line	Completed - Inspected	Light repair. Hand crew work.	3-5' line, REAF Webster, 8/24/23 - READ Donnermeyer 08/27/2023
1388	Completed Dozer Line	Completed - Inspected	Light repair. Pull down dozer berms (minimal). Scatter vegetation across line. Fix some water bars (in place during stabilization phase). Block where line intersects roads.	READ Donnermeyer 08/27/2023
1034	Completed Dozer Line	In Progress	Full Meadow Repair, water bars on rest of line, line is a road so it will stay as a road but closed to public. Pinch point will be used to block public access.	Knock berms off dozer line to allow outslped water runoff. Water bars needed in eastern part of line. Create closure of road at pinch point where line heads off down the ridge. REAF Olin 8/25 Meadow habitat, flat, no water bars needed, will need sod reconstructed and seed/wood straw
1034	Completed Hand Line	Completed - Inspected		Inspected 9/9 REAF Van Norman
1034	Completed Hand Line	Completed - Inspected	Full Meadow Repair, water bars on rest of line, line is a road so it will stay as a road but closed to public. Pinch point will be used to block public access.	Knock berms off dozer line to allow outslped water runoff. Water bars needed in eastern part of line. Create closure of road at pinch point where line heads off down the ridge. REAF Olin 8/25 Meadow habitat, flat, no water bars needed, will need sod reconstructed and seed/wood straw
1034	Completed Hand Line	Completed - Inspected		Inspected 9/9 REAF Van Norman
1034	Completed Dozer Line	In Progress	Full Meadow Repair, water bars on rest of line, line is a road so it will stay as a road but closed to public. Pinch point will be used to block public access.	0909 Decompact soil, pull in berm and recontour. Replace large boulders at parking area. Through forested camping area recommend pull back berms, spread slash. Seed, save plant material if possible for replanting. REAF Olin 8/25. :: 9/12 Mini-excavator repaired. Still needs straw mulch and seed, 9/12 REAF Van Norman