

118°18.5'W 118°17.5'W 118°16.5'W 118°15.5'W 118°14.5'W 118°13.51'W 118°12.5'W 118°11.5'W 118°10.5'W 118°9.5'W

Structures Map


Bulldog Mountain
WACOF-2348
8/26/2021 Day

5,173 acres at 08/22/2021@2100



0 0.25 0.5 1 Miles

- Defensible - Prep and Hold
- Defensible - Stand Alone
- Non-Defensible - Prep and Leave

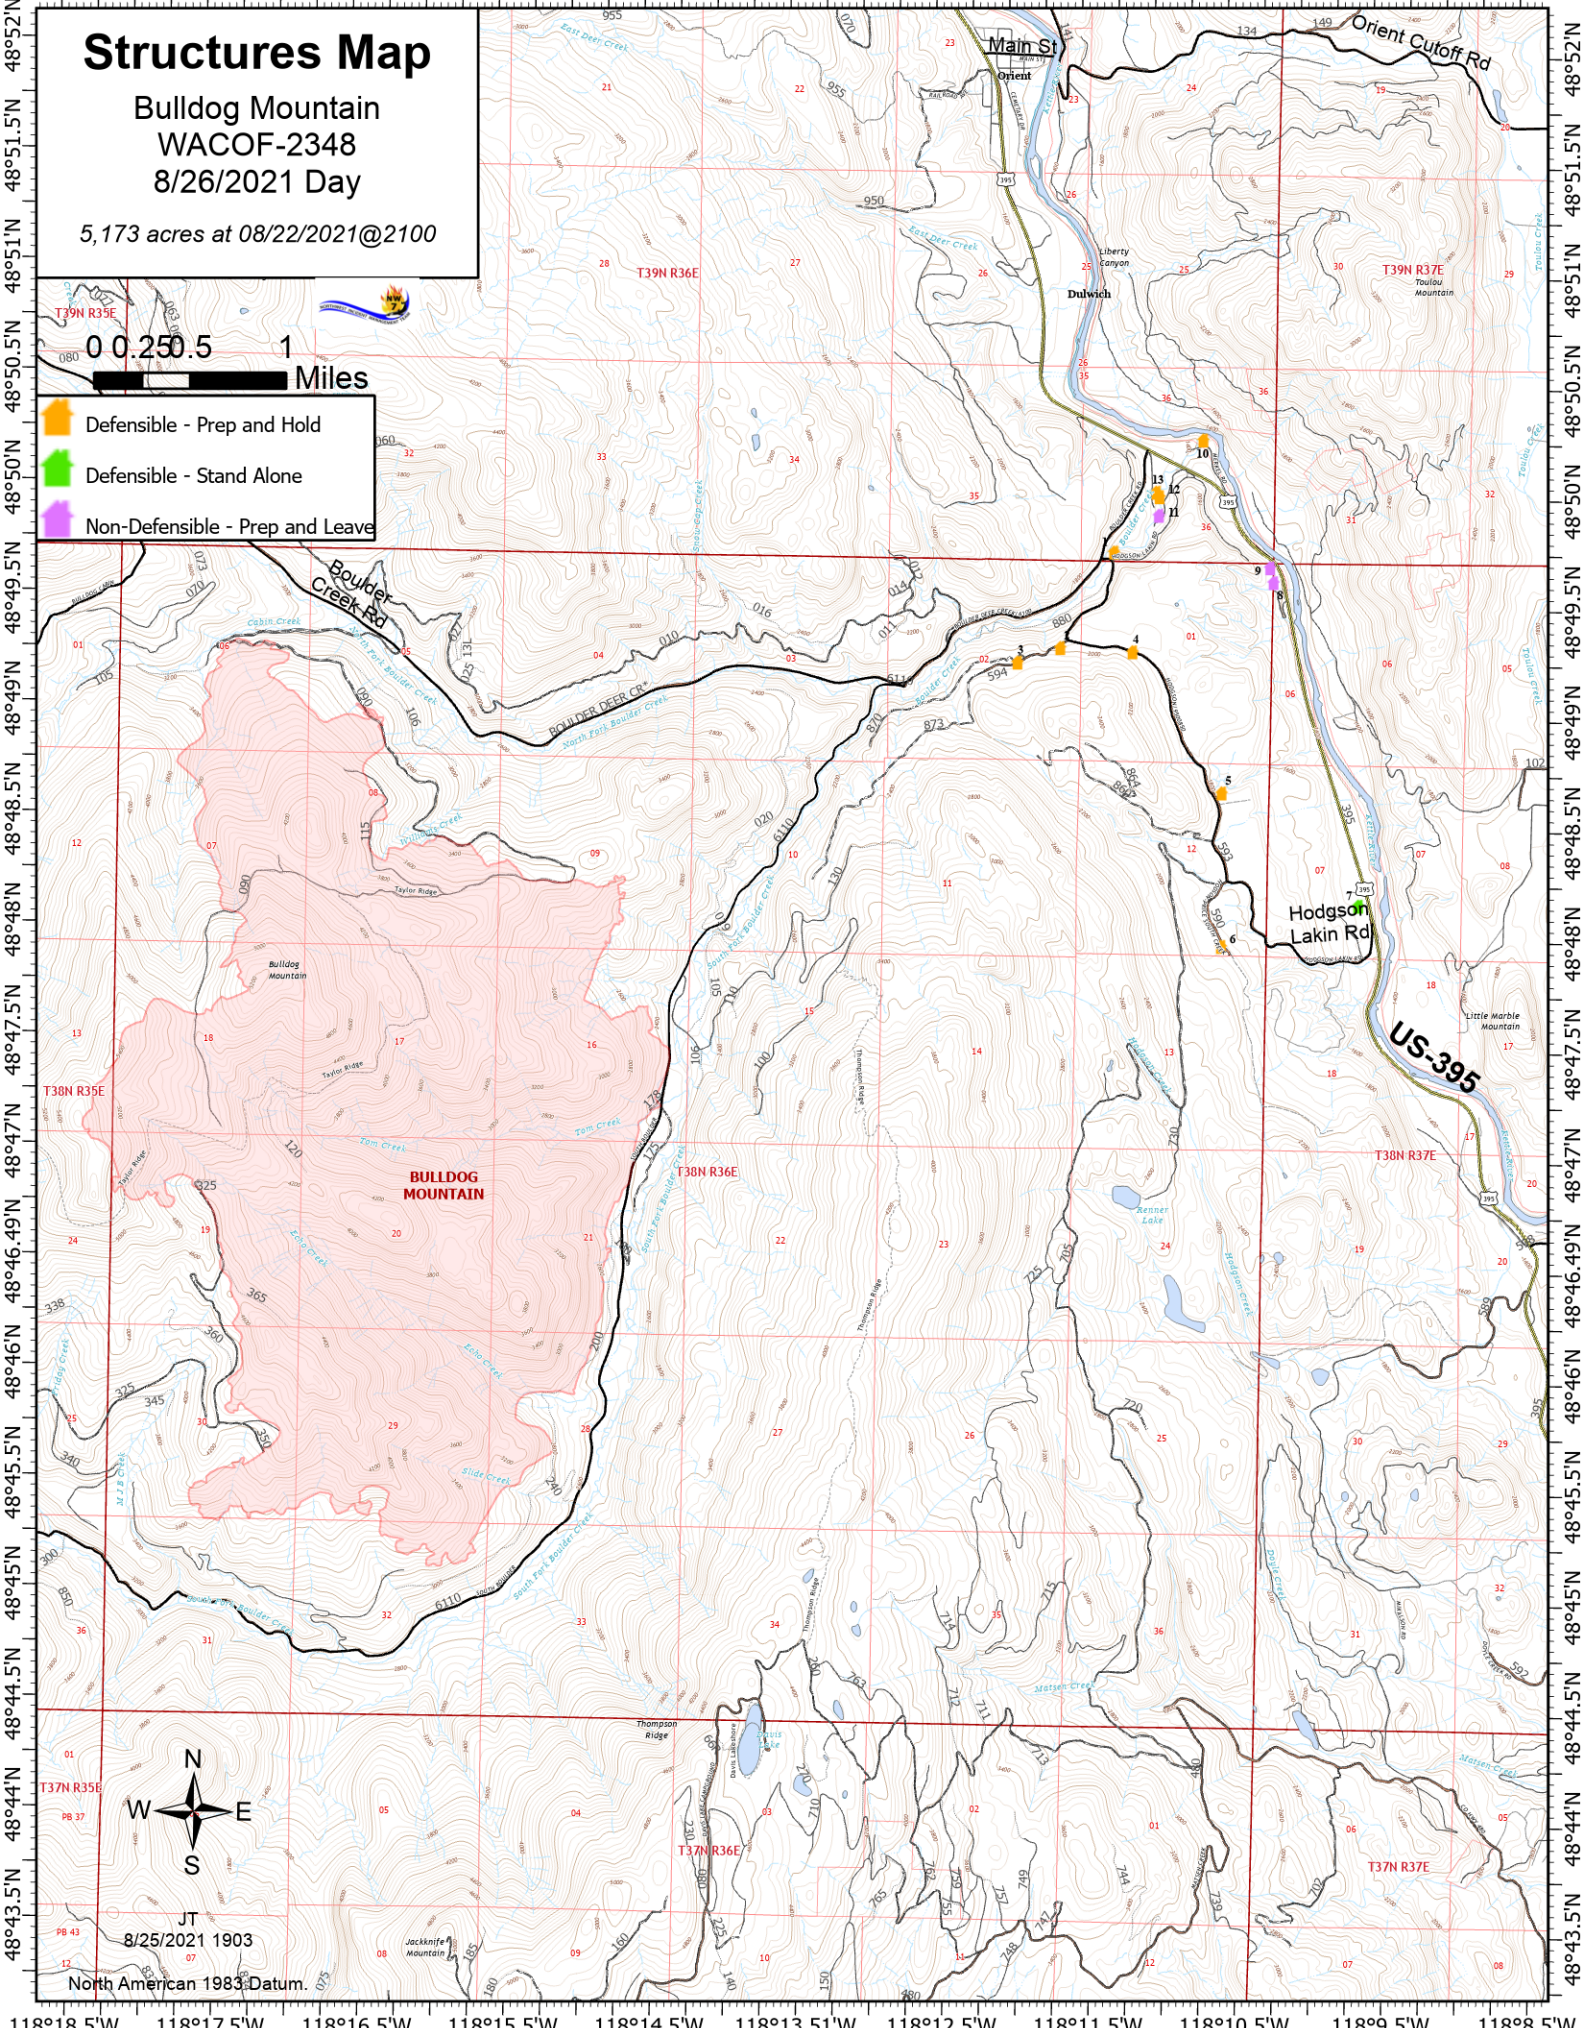

JT
8/25/2021 1903

North American 1983 Datum.

118°18.5'W 118°17.5'W 118°16.5'W 118°15.5'W 118°14.5'W 118°13.51'W 118°12.5'W 118°11.5'W 118°10.5'W 118°9.5'W

Bulldog_Mountain



WACOF-002348



Location: ,

Coordinates (DDM): 48° 49.74243949' N, 118° 11.47699773' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 1
Collected Date/Time:
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures: 1
Is the building Occupied?: Unknown
Outbuildings: 1
Fuel Surrounding Structure: Shrub or timber
Defensible Space: 30 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Electrical Power: Yes
Gas to Structure: Unknown
Hazards: Power lines
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 2
Mitigation Description: Brush out, scratch line, porta tanks
Resources Needed to Protect Structure: x1 Type 6 Engine, x1 20 Person Crew
FIRESCOPE Tactics:
Notes: Horse Barn with two horses

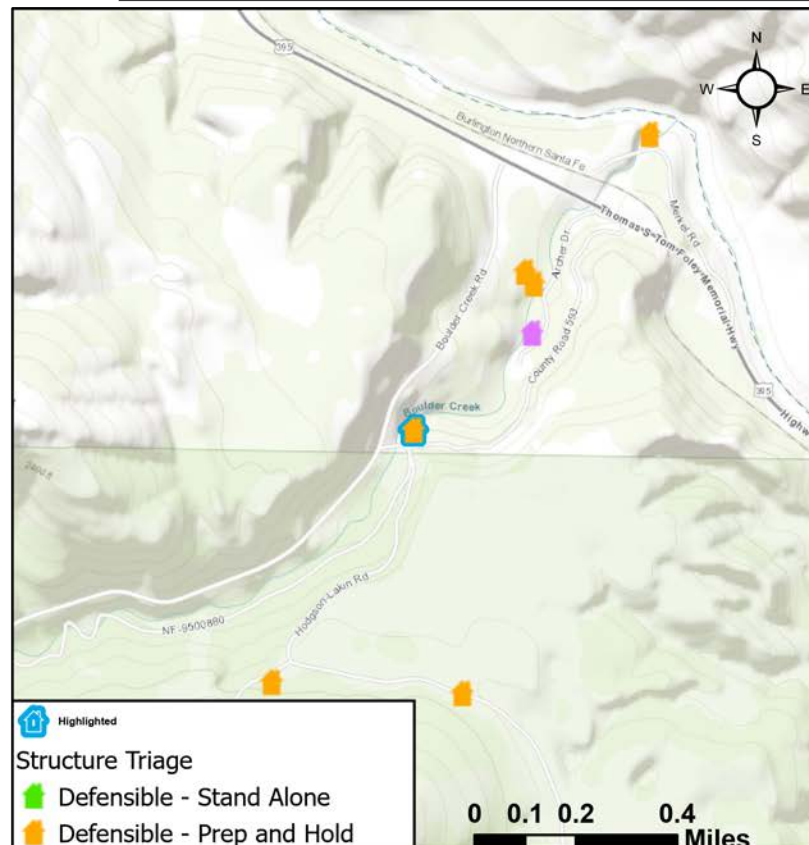

Bulldog_Mountain



WACOF-002348



Location: ,

Coordinates (DDM): 48° 50.25515369' N, 118° 10.87664528' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 10
Collected Date/Time:
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures: 1
Is the building Occupied?: Yes
Outbuildings:
Fuel Surrounding Structure: Shrub or timber
Defensible Space: 100 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Electrical Power: Yes
Gas to Structure: Unknown
Hazards:
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 2
Mitigation Description: Removal of lateral fuels, Scratch line, possible dozer line, porta tanks
Resources Needed to Protect Structure: x1 Type 6 Engine, x1 20 Person Hand Crew
FIRESCOPE Tactics:
Notes:

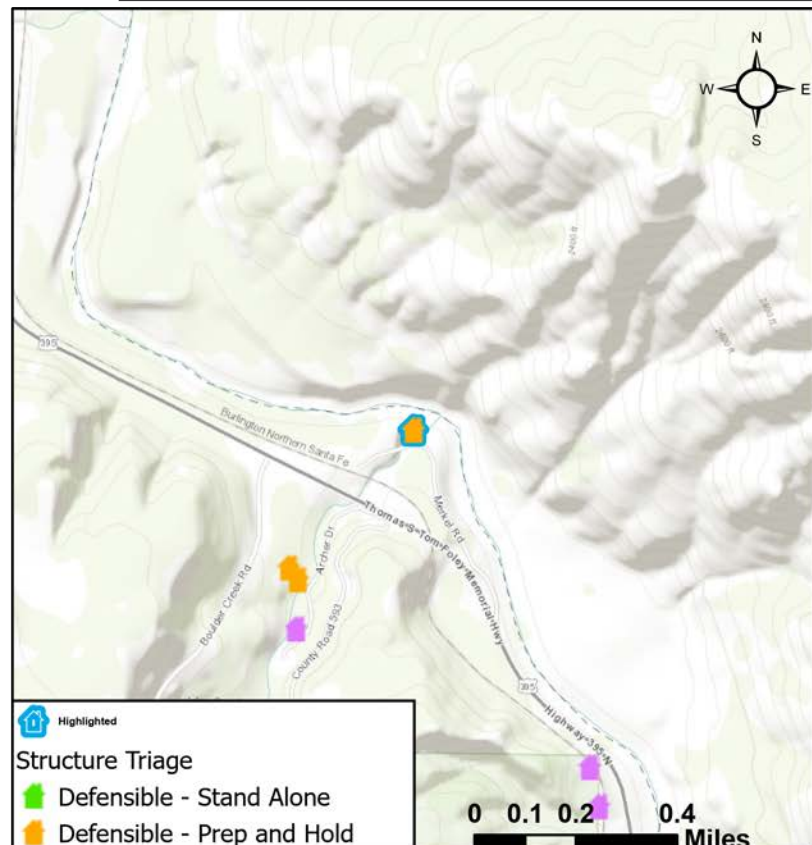

Bulldog_Mountain

WACOF-002348

Location: 38 Archer Drive Hwy 395 ,

Coordinates (DDM): 48° 49.91161857' N, 118° 11.17349082' W



Triage Category: Non-Defensible, Prep and Leave

FIRESCOPE Triage Category:

Structure Number: 11

Collected Date/Time:

Collected By:

Inspector's Position: Division

Type of Structure: Residential

Primary Structures: 1

Is the building Occupied?: Yes

Outbuildings: 3

Fuel Surrounding Structure: Shrub or timber

Defensible Space: 100 ft treated

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Electrical Power: Unknown

Gas to Structure: Unknown

Hazards:

Access to Site:

Describe Access:

Comm With ICP: Yes

Water Source: Reliable water source nearby

Safety Zone Present:

Mitigation Time (in hours): 4


Mitigation Description: Removal of lateral fuels, scratch line, possible dozer line, porta tanks

Resources Needed to Protect Structure: x1 Type 6

Engine, x1 20 Person Crew

FIRESCOPE Tactics:

Notes:

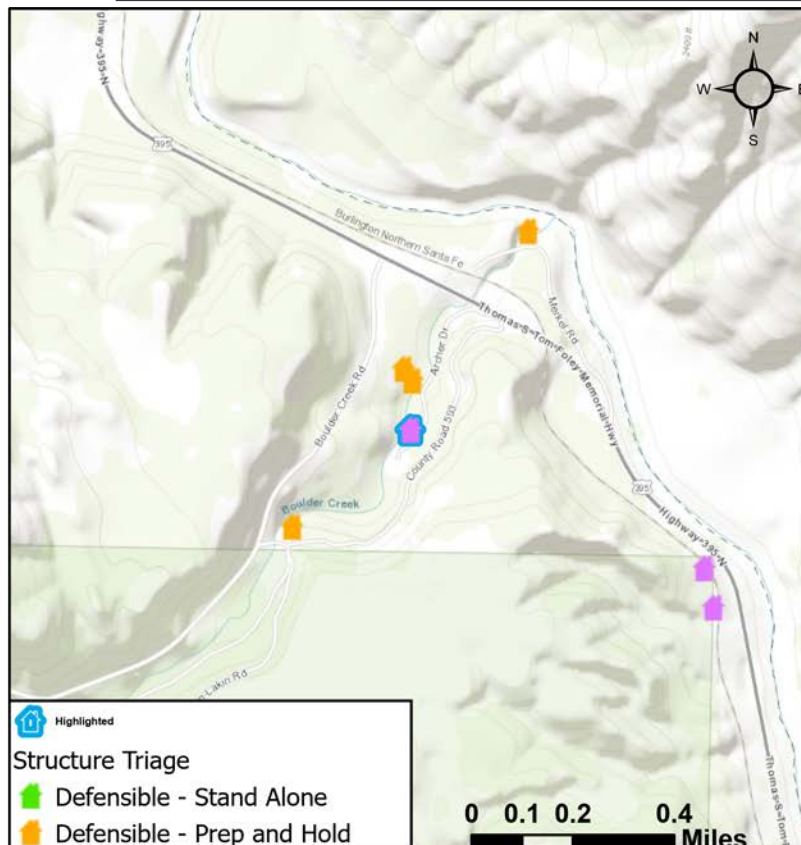

Bulldog_Mountain



WACOF-002348



Location: ,

Coordinates (DDM): 48° 49.99590962' N, 118° 11.17111948' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 12
Collected Date/Time:
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures:
Is the building Occupied?: Yes
Outbuildings: 3
Fuel Surrounding Structure: Shrub or timber
Defensible Space: 100 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Electrical Power: Yes
Gas to Structure: Unknown
Hazards:
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 4
Mitigation Description: Removal of lateral fuels, Brush out, Scratch Line, porta tanks
Resources Needed to Protect Structure: x1 Type 6 Engine, x1 20 Person Hand Crew
FIRESCOPE Tactics:
Notes:

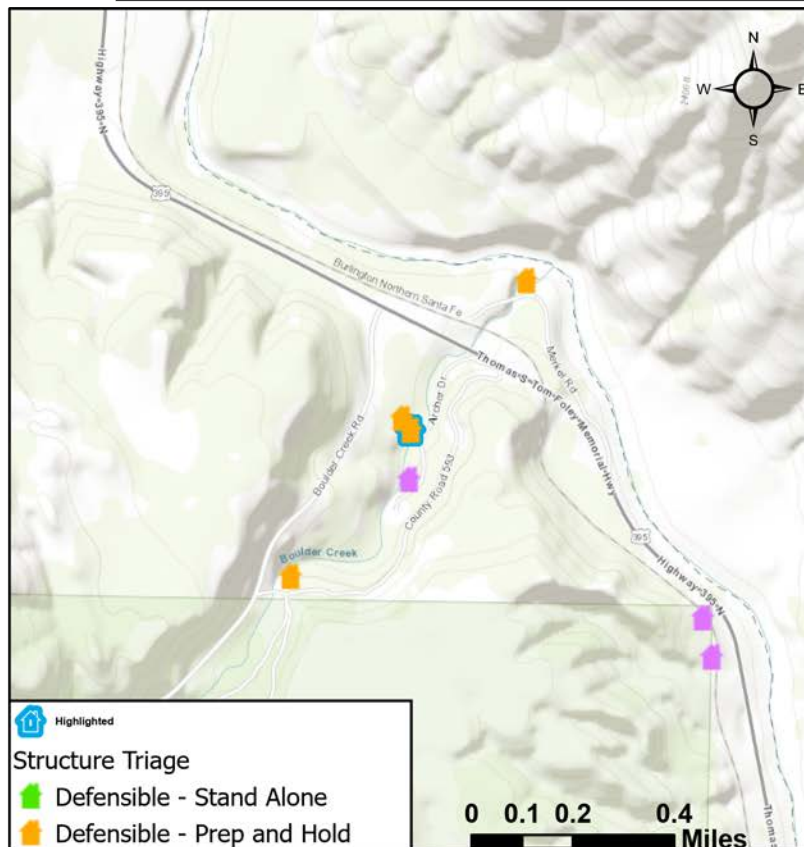

Bulldog_Mountain



WACOF-002348



Location: ,

Coordinates (DDM): 48° 50.01590137' N, 118° 11.19440145' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 13
Collected Date/Time:
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures: 1
Is the building Occupied?: Yes
Outbuildings: 3
Fuel Surrounding Structure: Shrub or timber
Defensible Space: 100 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Electrical Power: Yes
Gas to Structure: Unknown
Hazards:
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 4
Mitigation Description: Removal of lateral fuels, scratch line, brush out, possible dozer line, porta tanks
Resources Needed to Protect Structure: x1 Type 6 Engine, x1 20 Person Hand Crew
FIRESCOPE Tactics:
Notes:

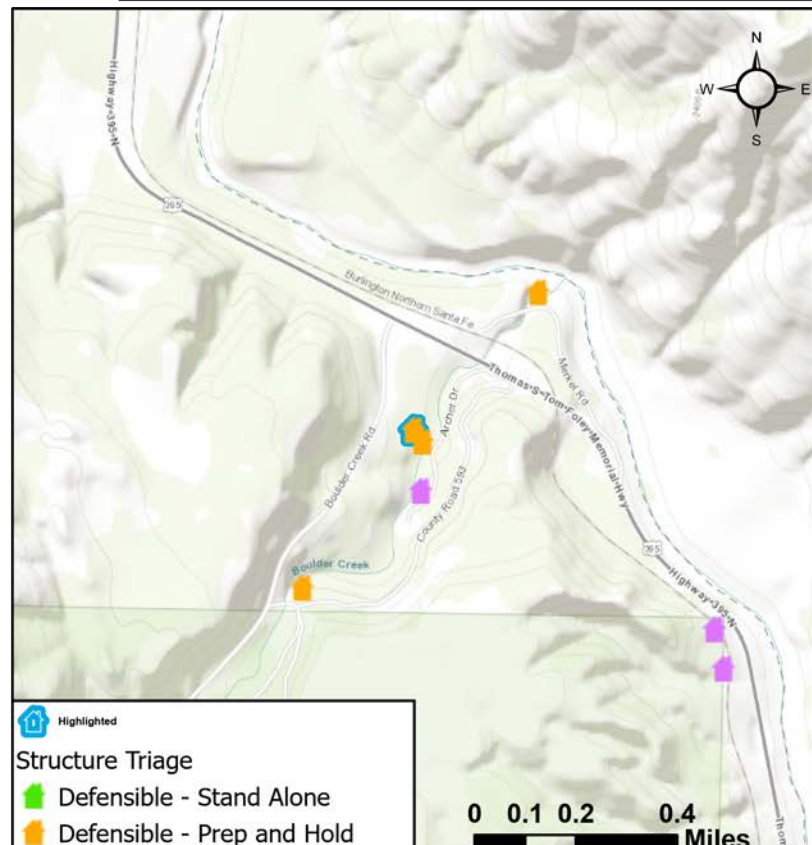

Bulldog_Mountain



WACOF-002348



Location: ,

Coordinates (DDM): 48° 49.30685820' N, 118° 11.83513541' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 2
Collected Date/Time:
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures: 2
Is the building Occupied?: Yes
Outbuildings: 3
Fuel Surrounding Structure: Shrub or timber
Defensible Space: 100 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Log construction
Electrical Power: Yes
Gas to Structure: Unknown
Hazards:
Access to Site: T1 Engine
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 2
Mitigation Description: Sprinkle system, porta tank, scratch line
Resources Needed to Protect Structure: x2 Type 6 Engine, x1 20 Person Crew
FIRESCOPE Tactics:
Notes:

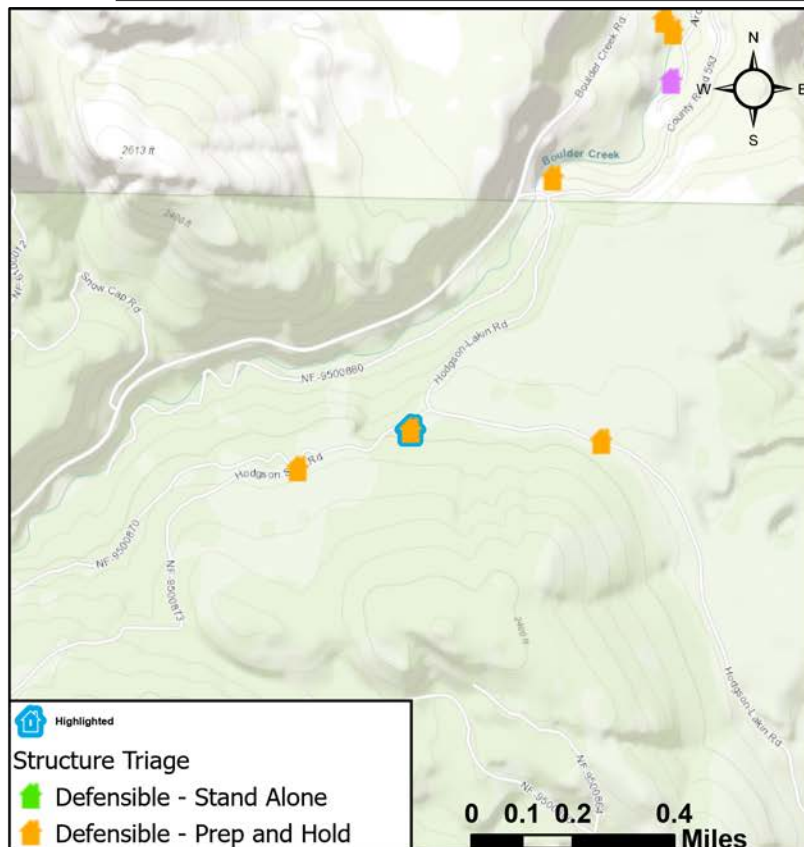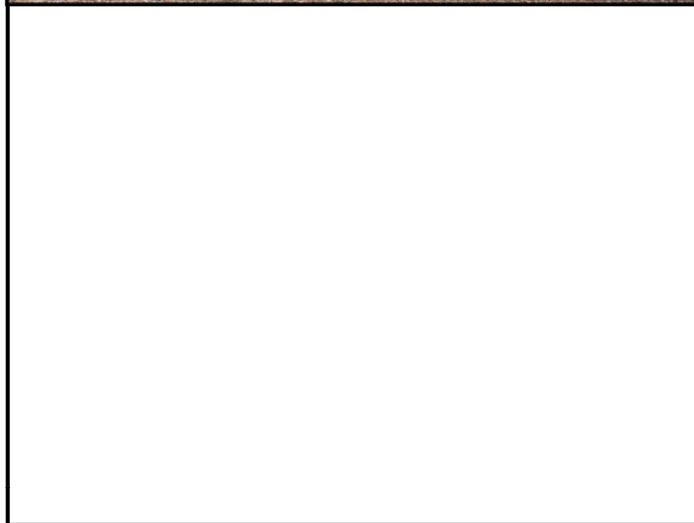

Bulldog_Mountain


WACOF-002348



Location: ,

Coordinates (DDM): 48° 49.23782824' N, 118° 12.12669487' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 3
Collected Date/Time:
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures: 1
Is the building Occupied?: Yes
Outbuildings: 4
Fuel Surrounding Structure: Shrub or timber
Defensible Space: 100 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Electrical Power: Yes
Gas to Structure: Unknown
Hazards: Power lines
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 2
Mitigation Description: Brush out, tree felling, scratch line, possible dozer line
Resources Needed to Protect Structure: x1 Type 6 Engine, x1 20 Person Hand Crew
FIRESCOPE Tactics:
Notes: Hay Barn across road

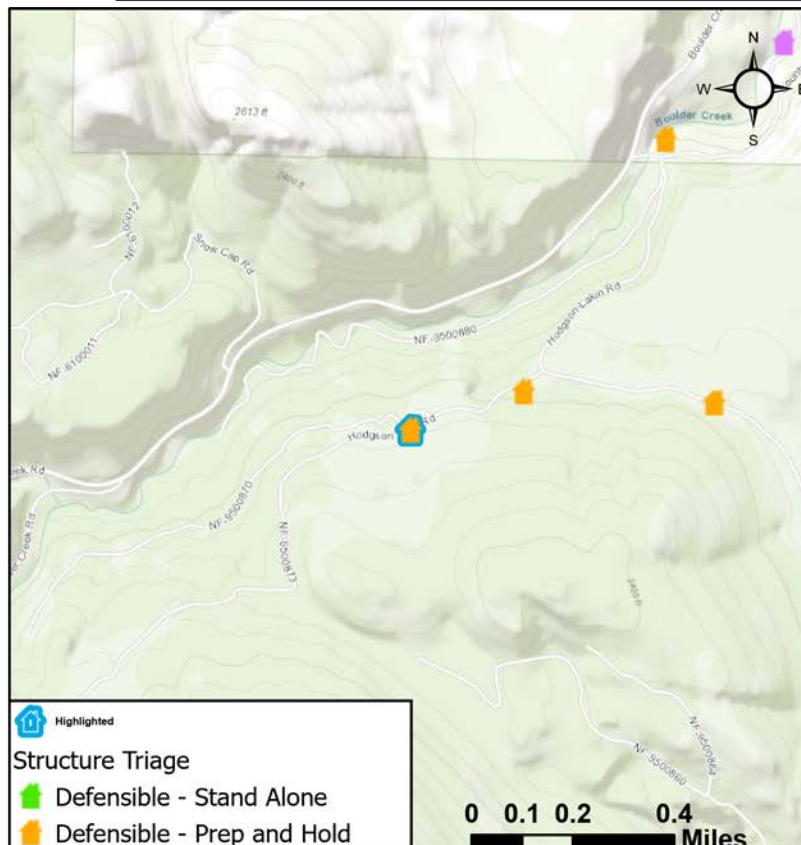

Bulldog_Mountain



WACOF-002348



Location: ,

Coordinates (DDM): 48° 49.29279426' N, 118° 11.33996609' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 4
Collected Date/Time:
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures: 1
Is the building Occupied?: Yes
Outbuildings: 4
Fuel Surrounding Structure: Shrub or timber
Defensible Space: 30 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Electrical Power: Yes
Gas to Structure: Unknown
Hazards: Power lines
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 4
Mitigation Description: Brush out, lateral fuels, possible dozer line, scratch line, porta tanks
Resources Needed to Protect Structure: x2 Type 6 Engines, x1 20 Person Crew
FIRESCOPE Tactics:
Notes:

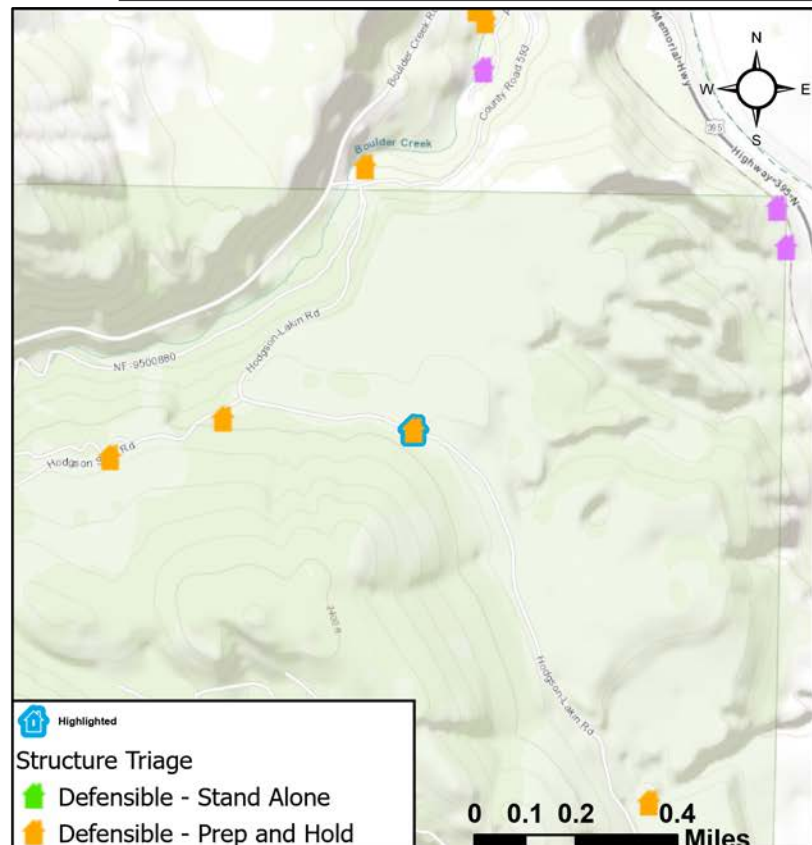

Bulldog_Mountain




WACOF-002348



Location: ,

Coordinates (DDM): 48° 48.66078767' N, 118° 10.71474879' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 5
Collected Date/Time: 8/25/2021 12:38:12 AM
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures: 1
Is the building Occupied?: Yes
Outbuildings: 3
Fuel Surrounding Structure: Shrub or timber
Defensible Space: 100 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Electrical Power: Yes
Gas to Structure: Unknown
Hazards: Power Lines
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 2
Mitigation Description: Removal of lateral fuels, Brush Out, Scratch Line, Possible dozer line, Porta tanks
Resources Needed to Protect Structure: x2 Type 6 Engine, x2 20 Person Hand Crew
FIRESCOPE Tactics:
Notes:

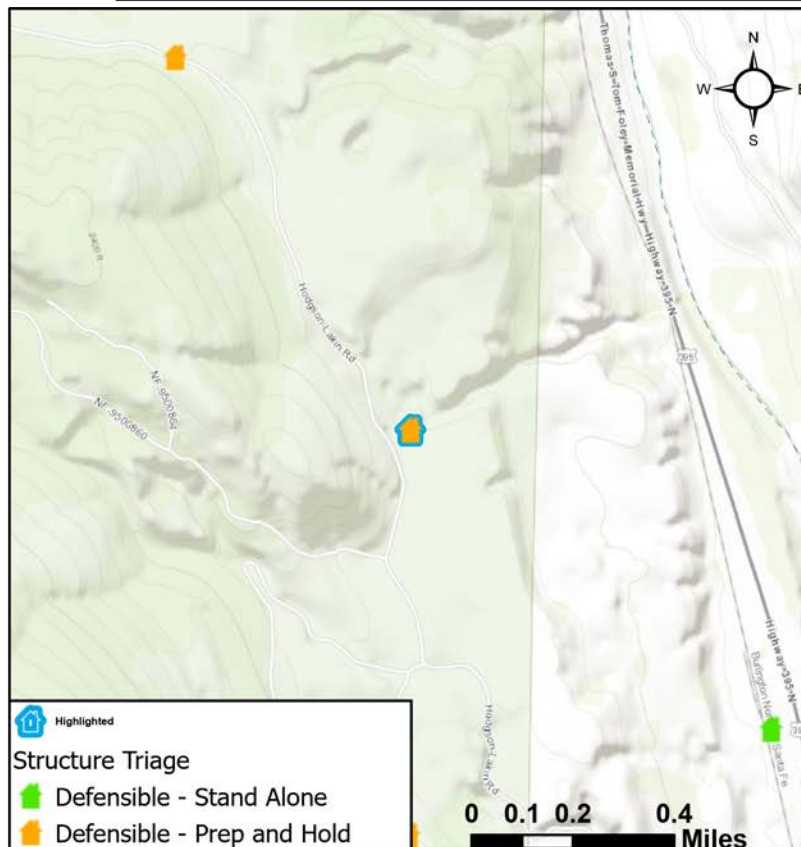

Bulldog_Mountain



WACOF-002348



Location: ,

Coordinates (DDM): 48° 47.96674570' N, 118° 10.70344916' W

Triage Category: Defensible, Prep and Hold
FIRESCOPE Triage Category:
Structure Number: 6
Collected Date/Time: 8/23/2021 10:22:10 PM
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures:
Is the building Occupied?: No
Outbuildings: 2
Fuel Surrounding Structure: Shrub or timber
Defensible Space: Less than 30 ft treated
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Electrical Power: Yes
Gas to Structure: Unknown
Hazards: Power lines
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: No reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours): 2
Mitigation Description: Brush out, scratch line, possible dozer line
Resources Needed to Protect Structure: Engine
FIRESCOPE Tactics:
Notes:

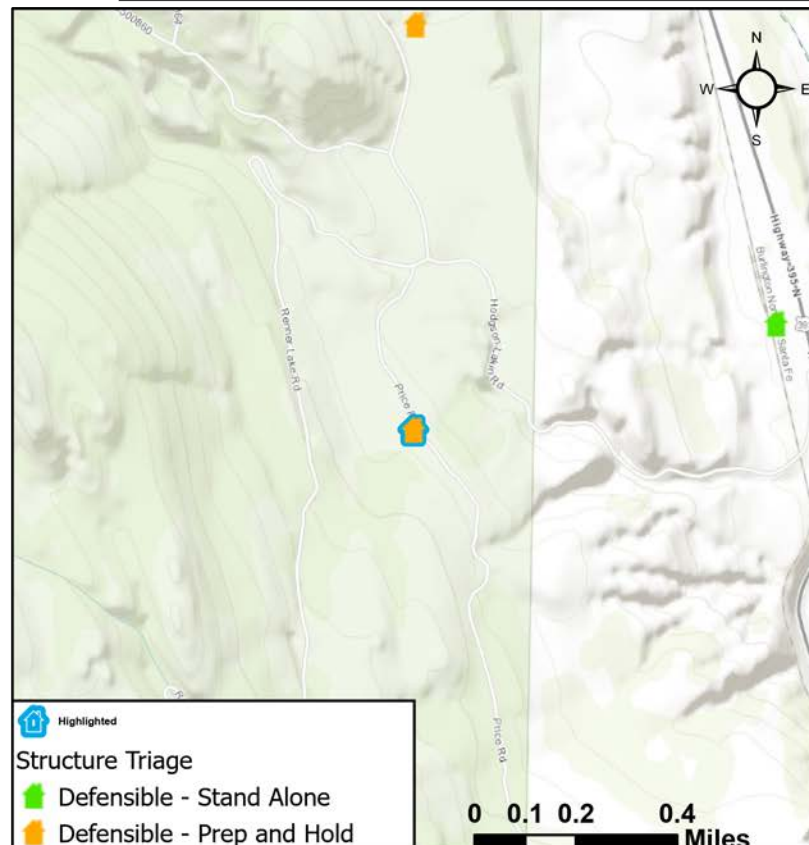

Bulldog_Mountain



WACOF-002348



Location: ,

Coordinates (DDM): 48° 48.15824755' N, 118° 09.76736638' W

Triage Category: Defensible, Stand Alone
FIRESCOPE Triage Category:
Structure Number: 7
Collected Date/Time:
Collected By:
Inspector's Position: Division
Type of Structure: Residential
Primary Structures:
Is the building Occupied?: No
Outbuildings:
Fuel Surrounding Structure: Shrub or timber
Defensible Space: More than 100ft treated
Roof Material: Noncombustible or not applicable
Siding Material:
Electrical Power: Unknown
Gas to Structure:
Hazards: Rail Line
Access to Site:
Describe Access:
Comm With ICP: Yes
Water Source: Reliable water source nearby
Safety Zone Present:
Mitigation Time (in hours):
Mitigation Description:
Resources Needed to Protect Structure:
FIRESCOPE Tactics:
Notes:

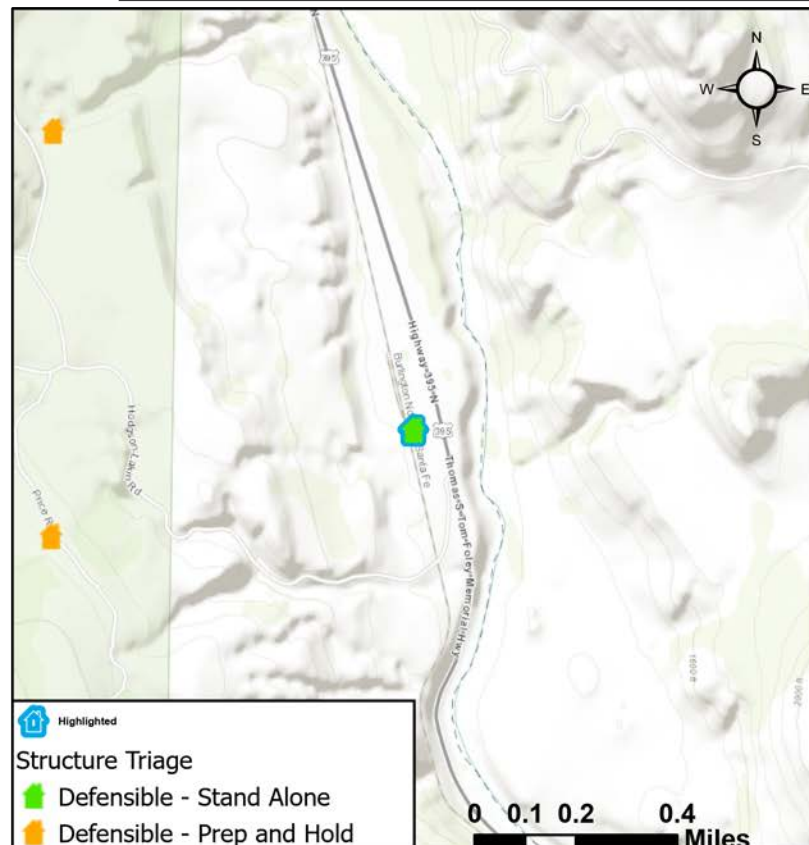

Bulldog_Mountain

WACOF-002348



Location: ,

Coordinates (DDM): 48° 49.61532817' N, 118° 10.38080419' W

Triage Category: Non-Defensible, Prep and Leave

FIRESCOPE Triage Category:

Structure Number: 8

Collected Date/Time:

Collected By:

Inspector's Position: Division

Type of Structure: Residential

Primary Structures:

Is the building Occupied?: Unknown

Outbuildings:

Fuel Surrounding Structure: Shrub or timber

Defensible Space: Less than 30 ft treated

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Electrical Power: Unknown

Gas to Structure: Unknown

Hazards:

Access to Site:

Describe Access:

Comm With ICP: Yes

Water Source: Reliable water source nearby

Safety Zone Present:



Mitigation Time (in hours): 4

Mitigation Description: Removal of lateral fuels, Brush out, Scratch Line, Possible dozer line, porta tanks

Resources Needed to Protect Structure: x1 Type 6 Engine, x1 20 Person Hand Crew

FIRESCOPE Tactics:

Notes:

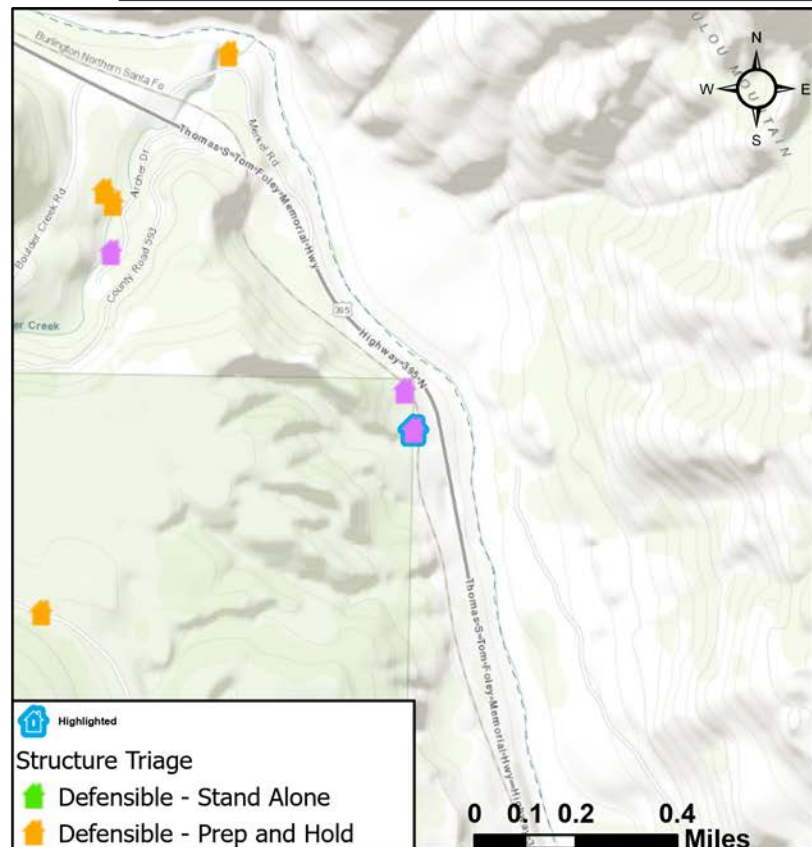

Bulldog_Mountain

WACOF-002348

Location: 25675 Hwy 395 N,

Coordinates (DDM): 48° 49.68229195' N, 118° 10.40581681' W



Triage Category: Non-Defensible, Prep and Leave

FIRESCOPE Triage Category:

Structure Number: 9

Collected Date/Time:

Collected By:

Inspector's Position: Division

Type of Structure: Residential

Primary Structures: 1

Is the building Occupied?: Yes

Outbuildings: 3

Fuel Surrounding Structure: Shrub or timber

Defensible Space: 100 ft treated

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Electrical Power: Yes

Gas to Structure: Unknown

Hazards:

Access to Site:

Describe Access:

Comm With ICP: Yes

Water Source: Reliable water source nearby

Safety Zone Present:

Mitigation Time (in hours):

Mitigation Description: Removal of lateral fuels, Brush out, Scratch line, possible dozer line, porta tanks

Resources Needed to Protect Structure: x1 Type 6 Engine, x1 20 Person Hand Crew

FIRESCOPE Tactics:

Notes:

