


**WY SUPPRESSION REPAIR**  
**NORTH EDEN**  
**13,763 ACRES**  
**UT-BRS-000797**

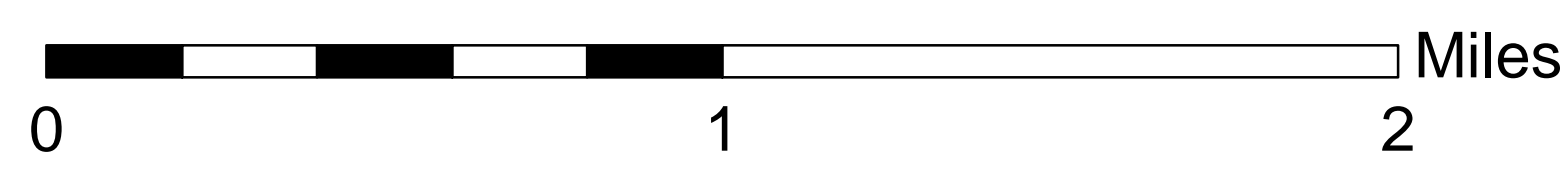

**DIV B**

**DIV G**

**DIV A**

**DIV K**

ID	Priority	Line Type	Length (mi)	Comments
1	Low	Dozer / improved road	3.2	#1 priority of the low priority lines. Road that was improved or made wider. Must remain a useable road. Pull in berms, place water bars where needed, re-seed with native sage-mix mountain shrub type.
2	High	Dozer / 2-track	1.9	Mostly follows fire edge not two tracks. Moderate repair needed. Portion on 2-track must remain drivable. Where does not follow road, contour to slope. Pull in berms, add water bars where needed, reseed.
3	Moderate	Dozer / 2-track	1.2	Mostly on 2-track. 90% minimal to moderate repair needed. Must remain a useable road. Pull in berms, place water bars where needed, reseed with native sage-mix.
4	Low	Dozer-disc / improved road	2.2	#2 priority of the low priority lines. Road that was improved or made wider by both disk and dozer. Must remain a useable road. Pull in berms, place water bars where needed, reseed with native sage-mix.
5	High	Dozer	0.1	Black both sides. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide.
6	High	Dozer	1.1	Black both sides. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide.
7	High	Dozer	0.1	Black both sides. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide.
8	High	Dozer	0.1	Black both sides. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide.
9	High	Dozer	0.1	Black both sides. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide.
10	High	Dozer	1.0	Dozer Line Follows fire edge not two tracks. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide.
11	High	Dozer / cut fence	0.3	Follows fire edge not two tracks. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide. Fence cut, needs spliced.
12	High	Dozer / cut fence	2.1	Follows fire edge not two tracks. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide. Fence cut, needs spliced.
13	High	Dozer / cut fence	0.4	Follows fire edge not two tracks. Shall be contoured to slope. Pull in berms, add water bars where needed, re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide. Fence cut, needs spliced.
14	Low	Dozer / staging area	0.1	Pull in berms, reseed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide.
15	Unknown	Fenceline	2.4	County road right of way fence, burned by burnout, needed to keep livestock off of road.
16	Low	Disc	0.6	Disk line no mechanical rehab needed. Re-seed with native sage-mix mountain shrub type seed mix, treat with plateau herbicide.
17	Low	Dozer / improved road	1.2	#3 priority of the low priority lines. Road that was improved or made wider. Must remain a useable road. Pull in berms, place water bars where needed, reseed with native sage-mix.

**Repair Priority**

- High
- Moderate
- Low
- Unknown
- - - Uncontrolled Fire Edge
- Completed Line
- - - - - Completed Dozer Line
- o - o Other
- ) ( Division Break
- Historic Site
- Power Line
- Gas Pipeline

**Land Status**

- Bureau of Land Management
- Fish & Wildlife Service
- Private
- State