

**STRUCTURE
PROTECTION PLAN
FOR MACINTOSH
MANOR 07/29/2017**

Structure Protection Plan

Macintosh Manor

Location: On Hwy 12 South of Lolo to the Old Hwy 93 turnoff area

Description: All structures East of Highland Dr. are below the toe of the slope and are in grass with a few stringers of timber where there is water. Above this about on Folsom Rd. there are 10 structures that are up on the slope in the timber near the primary line that will need protection. This area does not have any ground water except for a small ditch near Queen Anne's Ln. near Hwy 93, this is draftable.

Safety Zone: There are some grass fields in this area but they are dry grass. The best safety would be back out to Old Hwy 93.

Timing: If the fire progresses down Mormon creek or down the slope above this section.

Plan:

- The residences below the toe of the slope are in grass and will need 2 Type 6 engines to patrol this area.
- For the structures on the slope that are in the timber: There is no ground water available in this area for firefighting. The road system is in good shape for Type 3 Engines. The structures in this area for the most part have clear space around them and most have a green lawn. Set up several pumpkins on Folsom Rd. for filling engines. A Strike Team of Type 3 Engines should patrol and hold this area. A Water Tender will be needed for the Pumpkins. There is not a good safety zone in this area but several of the green lawn may be used for 1-2 engines.

Needs:

4 – 3000 gallon pumpkins

1 Strike Team of Type 3 Engines

3 – Type 6 Engines

1 – Water Tender

Structure Triage Information



Structure Number:
Structure Name: 13460 Sapphire Dr
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.95736
GPS Location, Long. 114 4.65474
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Non-Defensible, Prep and Leave
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Overhead
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Notes: Approximately 500 gallon pool in back yard. GPS location is incorrect

Where is Safety Zone:
Primary Structures:

Outbuildings:
Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Underground

Best Access From: Vann dr

Collected By: AZ-TNF 1265
Photo 1

Collected Date/Time: 07/29/2017 16:27:46
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 15118 Rock Ridge Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.47192
GPS Location, Long. 114 6.22134
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Terrain, No Turn Around, Animals, HazMat

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Notes: Gate code: 1234.

Best Access From: top.

Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the

Collected By: E 632

Collected Date/Time: 07/29/2017 16:25:34

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 15222 Rock Ridge Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.49058
GPS Location, Long. 114 6.11574
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Terrain, HazMat

Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Notes: Gate code: 1234.

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: top.
Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the

Collected By: E 632

Collected Date/Time: 07/29/2017 16:27:14

Photo 1



Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 15655 Queen Anne's Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.3356
GPS Location, Long. 114 5.45766
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Overhead
Hazards:
Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: AZ-TNF 1265

Where is Safety Zone: Field behind house.

Primary Structures:

Outbuildings:

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Queen Anne's Ln

Collected Date/Time: 07/29/2017 16:28:47

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 15675 Queen Anne's Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.2918
GPS Location, Long. 114 5.30148
Safety Zone Present: Yes **Where is Safety Zone:** Open fields surrounding the house.o
Type of Structure: Residential **Primary Structures:** **Outbuildings:**
Surrounding Fuels: Grass **Defensible Space:** >100 Feet
Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal **Siding Material:** Wood
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground **Gas to Structure:** Aboveground
Hazards: Animals
Access to Site: T3/4 Engine **Best Access From:** Queen Anne's Ln
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Notes: Travel trailer and tractor equipment outside home.

Collected By: AZ-TNF 1265
Photo 1

Collected Date/Time: 07/29/2017 16:26:52
Photo 2



Photo 3



Photo 4



Photo 3

Structure Triage Information



Structure Number:
Structure Name: 15697 Highland Dr
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.29156
GPS Location, Long. 114 5.97612
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Open Eaves
Electrical Power: Underground
Hazards: Terrain, Fuels, Septic Tank
Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Collected By: E-27 Florence

Where is Safety Zone: Down to Hwy 93. Five minutes

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Highland Road. Very last structure to the north

Collected Date/Time: 07/29/2017 16:29:11

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 15743 Highland Dr.
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.22748
GPS Location, Long. 114 5.95284
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Fuels, Animals, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None.
Collected By: E 632

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures:

Outbuildings:

Defensible Space: >100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom.

Collected Date/Time: 07/29/2017 16:27:41

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 15820 Dundee Drive
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.2063
GPS Location, Long. 114 5.59674

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Off Hwy 93 to Rowan Rd to Dundee north

Collected Date/Time: 07/29/2017 16:29:01

Photo 1

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 15853 Queen Anne's Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.15818
GPS Location, Long. 114 5.33166
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank
Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: None
Notes: Irrigation ditch 100 ft behind home.

Where is Safety Zone: Fields around home. Light fuels.

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Underground

Best Access From: Queen Anne's Rd off of Rowan Rd

Collected By: TNF-E65
Photo 1

Collected Date/Time: 07/29/2017 16:27:54
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 15855 Highland Drive
SubDivision: Macintosh Manor
GPS Location, Lat: 46 43.16688
GPS Location, Long: 114 5.93148

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal
Heat Traps: Wood Deck
Electrical Power:
Hazards: Fuels

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Vinyl

Gas to Structure:

Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to
Best Access From: highland drive. Right on highland and then a left on Folsom

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source:
Mitigation Time: 2-3 Hours
Notes: Gate at front entrance locked, structure looks unoccupied at this time

Collected By: Lolo 632

Collected Date/Time: 07/29/2017 16:27:11

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 15890 Queen Anns lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.15668
GPS Location, Long. 114 5.24964
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Hydrant
Mitigation Time: None Needed
Other Resources Needed to Protect: 1 engine to Patrol

Where is Safety Zone: Large grass field behind the house

Primary Structures:

Outbuildings:

Defensible Space: >100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Highway 93 to Rowan Road to Queen Anne's Lane

Notes: Propane tank on North side of barn, leach field for septic behind main structure. Sprinklers set around property. Large barn with metal siding and metal roof.

Collected By: COCO 482
Photo 1

Collected Date/Time: 07/29/2017 16:25:56
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 15910 Dundee Road
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.15194
GPS Location, Long. 114 5.52678
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Timber

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**
Defensible Space: >100 Feet

Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Animals, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Other Resources Needed to Protect: None.

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to Dundee.

Notes: Structure is stand alone, but may require wood be moved out from under the deck in the backyard.

Collected By: E 632

Photo 1

Collected Date/Time: 07/29/2017 16:27:14

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 15940 Highland Dr
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.1313
GPS Location, Long. 114 5.92674

Escape route: Out to Hwy 93. Travel time 15 minutes

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Animals, HazMat

Where is Safety Zone: Zone: between Highland and Dundee.

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Underground

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland

Collected Date/Time: 07/29/2017 16:26:03

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16050 Maiden Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.07268
GPS Location, Long. 114 5.15406

Multiple open fields between Highlands Rd and Hwy 93. Maiden Ln back to

Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: One patrolling engine
Collected By: COCO 482

Where is Safety Zone: Rowan Rd to highway 93

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Highway 93 to Rowan Rd to Maiden Ln

Collected Date/Time: 07/29/2017 16:26:50

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16067 Queen Anne's Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.04652
GPS Location, Long. 114 5.26962

Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: T6 patrol
Collected By: COCO 482

Where is Safety Zone: Queen Anne's Lane to Rowan Road to HWY 93, two designated safety zone

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: HWY 93 to Rowan Rd. to Queen Annes Lane

Collected Date/Time: 07/29/2017 16:27:07
Photo 2



Photo 1

Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16077 Dundee Drive
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.04388
GPS Location, Long. 114 5.65848

Escape route: Out to Hwy 93. Travel time 15 minutes

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards: Fuels,Septic Tank,HazMat

Where is Safety Zone: Zone: between Highland and Dundee

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to

Best Access From: highland drive. Right on highland

Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: None

Notes: Wood fencing surrounding back yard

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:27:28
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16079 Queen Anne's Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.05444
GPS Location, Long. 114 5.35104
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Metal
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards: Fuels,Septic Tank,HazMat
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Other Resources Needed to Protect: None

Where is Safety Zone: Large grass field to the east and north of the home

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Queen Anne's Rd off Rowan Rd

Notes: House surrounded by high grass and weeds that needs to be trimmed back 30 ft

Collected By: TNF-E65

Photo 1

Collected Date/Time: 07/29/2017 16:27:21

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16090 Dundee Road
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.05252
GPS Location, Long. 114 5.57172
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**
Defensible Space: >100 Feet

Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None.

Siding Material: Vinyl
Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to Dundee.

Notes: No continuous fuels up to the house. Area is surrounded by grass fields at hip height.

Collected By: E 632

Photo 1

Collected Date/Time: 07/29/2017 16:27:02

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16100 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.08984
GPS Location, Long. 114 6.0048

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Animals, HazMat

Where is Safety Zone: No safety zone on premises

Primary Structures: Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose, Hydrant
Mitigation Time: None Needed
Notes: Unclear if hydrant in yard is in working condition.

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected By: Lolo 632

Photo 1

Collected Date/Time: 07/29/2017 16:26:41

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16120 Falcon Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.98496
GPS Location, Long. 114 5.1723
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: T6 patrol
Collected By: COCO 482
Photo 1

Where is Safety Zone: Manicured lawn all around house
Primary Structures:
Defensible Space: >100 Feet
Outbuildings:
Siding Material: Wood
Gas to Structure: None
Best Access From: HWY 93 to Rowan Rd. to Falcon Lane

Collected Date/Time: 07/29/2017 16:25:23
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16121 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.02306
GPS Location, Long. 114 5.96862
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards: HazMat

Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: E 632

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the top.

Collected Date/Time: 07/29/2017 16:25:31

Photo 1



Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16123 Highland Dr.
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.99108
GPS Location, Long. 114 5.97468
Safety Zone Present: No **Where is Safety Zone:** South of structure at neighbors
Type of Structure: Residential **Primary Structures:** **Outbuildings:**
Surrounding Fuels: Grass **Defensible Space:** 30-50 Feet
Structure Triage Category: Non-Defensible, Prep and Leave
Roof Material: Composite **Siding Material:** Wood
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground **Gas to Structure:** Aboveground
Hazards: Fuels, No Turn Around, Septic Tank
Access to Site: T6 Engine **Best Access From:** Highland dr
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: More Than 5 Hours
Notes: Unkempt with small equipment, tires etc.

Collected By: E-27 Florence
Photo 1



Photo 3

Collected Date/Time: 07/29/2017 16:26:47
Photo 2



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16125 Queen Anns lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.97848
GPS Location, Long. 114 5.30394
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass,Shrub,Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose,Creek
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: Type 6 to patrol

Where is Safety Zone: Escape route out Queen Anns lane to Rowan Rd to highway 93

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Highway 93 to Rowan Rd to Queen Anns lane

Notes: Large Seasonal Creek flowing for irrigation purposes. Large metal barn at the rear of the property. Many sprinklers set in place around to property flowing water.

Collected By: COCO 482

Photo 1

Collected Date/Time: 07/29/2017 16:25:58

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16130 Queen Anne's In
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.01136
GPS Location, Long. 114 5.25846
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: One engine to patrol
Notes: No prep needed

Where is Safety Zone: Best option is on queen Anne's lane to Rowan Rd then out to highway 93

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Rowan Rd to highway 93

Collected By: COCO 482

Photo 1

Collected Date/Time: 07/29/2017 16:27:56

Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16155 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.97686
GPS Location, Long. 114 6.06366
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None.
Collected By: E 632

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, Folsom Rd.

Collected Date/Time: 07/29/2017 16:27:58

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16170 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.0632
GPS Location, Long. 114 6.08166

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: None

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Notes: 2400 hundred gallon cistern with sprinkler system protecting structure, owner has done fuel mitigation work

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected By: Lolo 632

Collected Date/Time: 07/29/2017 16:27:54

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16170 Queen Ann's Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.9681
GPS Location, Long. 114 5.25558
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: Engine crew.
Collected By: COCO 482

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to Dundee.

Collected Date/Time: 07/29/2017 16:28:23

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16190 Highland Dr
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.0029

GPS Location, Long. 114 5.89356

Safety Zone Present: No

Where is Safety Zone: 5 minutes out to Hwy 93

Type of Structure: Residential

Primary Structures:

Outbuildings:

Surrounding Fuels: Grass

Defensible Space: 50-100 Feet

Structure Triage

Category: Defensible, Prep and Hold

Roof Material: Composite

Siding Material: Wood

Heat Traps: Open Eaves, Wood Deck, Rain Gutters

Electrical Power: Underground

Gas to Structure: Aboveground

Hazards: Fuels, Septic Tank

Access to Site: T3/4 Engine

Best Access From: Highland Dr

Comm with ICP: Radio, Cell Service

Water Source: Faucet / Hose

Mitigation Time: 1-2 Hours

Notes: Loop driveway, with two points of entry.

Collected By: E-27 Florence
Photo 1

Collected Date/Time: 07/29/2017 16:29:18
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16191 Highland Dr.
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.9663
GPS Location, Long. 114 5.99232
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Metal
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank
Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Notes: Row of cottonwoods west of house, 50 feet away. One of the few structures with a large patch of green grass. Acceptable safety zone for an engine company. Attached garage.

Where is Safety Zone:
Primary Structures:
Outbuildings:
Defensible Space: 30-50 Feet
Siding Material: Wood
Gas to Structure: Aboveground
Best Access From: Rowan to Highland

Collected By: E-27 Florence
Photo 1

Collected Date/Time: 07/29/2017 16:25:11
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16197 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.9549
GPS Location, Long. 114 6.1134
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards: HazMat

Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: E 632

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the top.

Collected Date/Time: 07/29/2017 16:28:59

Photo 1



Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16200 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.98622
GPS Location, Long. 114 6.09114

Escape route: Out to Hwy 93. Travel time 15 minutes
 Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: Fuels

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: None

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected Date/Time: 07/29/2017 16:27:09

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16210 Queen Anne's Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.93828
GPS Location, Long. 114 5.26152
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: Type 6 engine to patrol
Collected By: COCO 482
Photo 1

Where is Safety Zone: Front driveway and parking area, Good for three engines and crew

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Metal

Gas to Structure: Aboveground

Best Access From: HWY 93 to Rowan Road to Queen Anne's Lane

Collected Date/Time: 07/29/2017 16:26:19

Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16240 Falcon lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.93564
GPS Location, Long. 114 5.16642
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass

Where is Safety Zone: Large field behind main structure

Primary Structures:

Outbuildings:

Defensible Space: >100 Feet

Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground

Siding Material: Wood

Gas to Structure: Underground

Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: 1 engine to Patrol.

Best Access From: Highway 93, Rowan Road, Falcon Lane.

Notes: Propane tank and electrical on the north side of the house small barn in the backyard large field to the east. No prep work needed. I

Collected By: COCO 482
Photo 1

Collected Date/Time: 07/29/2017 16:26:57
Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16252 Folsom Road
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.98436
GPS Location, Long. 114 6.12516

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Terrain, Fuels, HazMat

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Notes: Good defensive space

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected By: Lolo 632

Photo 1

Collected Date/Time: 07/29/2017 16:29:09

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16295 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.92784
GPS Location, Long. 114 6.13266

Escape route: Out to Hwy 93. Travel time 15 minutes
 Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: HazMat

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected Date/Time: 07/29/2017 16:27:23
 Photo 2



Photo 1



Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16305 Highland Dr
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.92262

GPS Location, Long. 114 5.93394

Safety Zone Present: Yes

Type of Structure: Residential

Surrounding Fuels: Grass

Structure Triage

Category: Defensible, Prep and Hold

Roof Material: Composite

Heat Traps: Wood Deck,Rain Gutters

Electrical Power: Underground

Hazards:

Access to Site: T3/4 Engine

Comm with ICP: Radio,Cell Service

Water Source:

Mitigation Time: Less Than An Hour

Notes: Locked gate, so unsure on more detailed info

Where is Safety Zone: Large yard east of structure

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Highland drive

Collected By: E-27 Florence
Photo 1

Collected Date/Time: 07/29/2017 16:25:18
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16325 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.88566
GPS Location, Long. 114 6.17112
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: HazMat

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: None

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Notes: None.

Best Access From: top.
Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the

Collected By: E 632

Photo 1

Collected Date/Time: 07/29/2017 16:26:59

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16335 Highland Dr
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.89646
GPS Location, Long. 114 5.99922
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: Pumpkin and sprinklers
Collected By: E-27 Florence
Photo 1

Where is Safety Zone: Five to seven minute escape back to Hwy 93
Primary Structures:
Outbuildings:
Defensible Space: 50-100 Feet
Siding Material: Wood
Gas to Structure:
Best Access From: Highland drive...one way drive with turn around

Collected Date/Time: 07/29/2017 16:28:06
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16337 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.81852
GPS Location, Long. 114 6.15816

Escape route: Out to Hwy 93. Travel time 15 minutes
 Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: HazMat

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected Date/Time: 07/29/2017 16:28:43
 Photo 2

Photo 1



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16350 Falcon Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.8619
GPS Location, Long. 114 5.16078
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Owners
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: TNF-65

Where is Safety Zone: Field next to house. Falcon Ln back to Rowan Rd

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Rowan Rd

Collected Date/Time: 07/29/2017 16:27:02

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:

Structure Name: 16355 Queen Anne's Ln

SubDivision: Macintosh Manor

GPS Location, Lat. 46 42.8886

GPS Location, Long. 114 5.27754

Safety Zone Present: No

Type of Structure: Residential

Surrounding Fuels: Grass

Structure Triage

Category: Defensible, Prep and Hold

Roof Material: Composite

Heat Traps: Wood Deck, Rain Gutters

Electrical Power: Underground

Hazards: Fuels, Septic Tank

Access to Site: T3/4 Engine

Comm with ICP: Radio, Cell Service

Water Source: Faucet / Hose

Mitigation Time: Less Than An Hour

Notes: Field of tall cured grass to the east and north, accessible from Queen Anne's Ln

Where is Safety Zone: Down to Hwy 93, 2 to 3 minutes

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Vinyl

Gas to Structure:

Best Access From: Rowan Rd

Collected By: E-27 Florence

Photo 1

Collected Date/Time: 07/29/2017 16:26:16

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16374 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.88782
GPS Location, Long. 114 6.24996
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass,Shrub,Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Animals,HazMat

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: None

Access to Site: T3/4 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None.

Best Access From: Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the top.

Notes: Talked with owner about mowing down tall grasses in the area.

Collected By: E 632

Photo 1

Collected Date/Time: 07/29/2017 16:25:13

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16375 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.71082
GPS Location, Long. 114 6.4941
Safety Zone Present: No **Where is Safety Zone:** Ten minutes down winding road to Hwy 93
Type of Structure: Residential **Primary Structures:** **Outbuildings:**
Surrounding Fuels: Grass, Timber **Defensible Space:** 30-50 Feet
Structure Triage Category: Non-Defensible, Prep and Leave
Roof Material: Composite **Siding Material:** Wood
Heat Traps: Open Eaves, Wood Deck
Electrical Power: Underground **Gas to Structure:**
Hazards: Terrain, Fuels, No Turn Around, Septic Tank
Access to Site: T6 Engine **Best Access From:** Hwy 93 to Rowan...Dundee...sandy...highland...Folsom...
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Other Resources Needed to Protect: Sawyers to cut small dead standing ponderosa upslope.
Notes: Loop driveway. Less tactically challenging on southern fork of loop. Best ingress is south fork of driveway. Homeowner intends on setting sprinklers on the roof. A type 3 or 4 could access the structure from the south fork of the driveway. The homeowner

Collected By: E-27 Florence
Photo 1

Collected Date/Time: 07/29/2017 16:26:30
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16380 Queen Anne's Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.86592
GPS Location, Long. 114 5.28228
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass,Shrub,Timber
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank
Access to Site: T3/4 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose,Creek
Mitigation Time: 1-2 Hours
Other Resources Needed to Protect: Sawyers to cut ornamental shrubs away from structure...
Collected By: E-27 Florence

Where is Safety Zone: Large short green grass behind structure on east side...

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Masonry

Gas to Structure: Aboveground

Best Access From: Queen Anne's lane

Collected Date/Time: 07/29/2017 16:25:10

Photo 1

Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16395 Penny lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.83844
GPS Location, Long. 114 5.0472
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass

Where is Safety Zone: Large field adjacent to the structure.

Primary Structures: **Outbuildings:**
Defensible Space: >100 Feet

Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground

Siding Material: Wood

Gas to Structure: Aboveground

Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: One engine to patrol

Best Access From: Highway 93, Rowan Road, Penny Lane.

Notes: Propane tank on North side of structure, large barn adjacent to house wood siding composite roof, green grass surrounding all structures

Collected By: COCO 482
Photo 1

Collected Date/Time: 07/29/2017 16:28:07
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16405 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.81096
GPS Location, Long. 114 6.44058
Safety Zone Present: No **Where is Safety Zone:** Safety zone is about a ten minute drive back to Hwy 93
Type of Structure: Residential **Primary Structures:** **Outbuildings:**
Surrounding Fuels: Grass, Timber **Defensible Space:** 30-50 Feet
Structure Triage Category: Non-Defensible, Prep and Leave
Roof Material: Metal **Siding Material:** Wood
Heat Traps: Open Eaves
Electrical Power: Underground **Gas to Structure:** None
Hazards: Terrain, Fuels, No Turn Around, Animals, Septic Tank
Access to Site: T6 Engine **Best Access From:** Rowan Rd to Dundee Dr to Sandy Ln to Highland Dr to Folsom.
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose, Porta-Tank/Pumpkin
Mitigation Time: 3-4 Hours
Notes: Owner has a 450 gallon poly tank that he will have filled with an external pump available for our use. Owner is a general contractor, and therefore stores leftover supplies from jobs at his residence. Florence engine E-27 has homeowner's contact informat

Collected By: E-27 Florence
Photo 1

Collected Date/Time: 07/29/2017 16:27:41
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16420 Falcon Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.81816
GPS Location, Long. 114 5.16096
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Animals
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Collected By: TNF-65

Where is Safety Zone: Open space surrounding structure.

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Rowan Rd

Collected Date/Time: 07/29/2017 16:27:49

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16435 Falcon Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.81432
GPS Location, Long. 114 5.1987
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Notes: Owner has sprinkler system in yard.

Where is Safety Zone: Yard and fields surrounding structure
Primary Structures:
Defensible Space: >100 Feet
Outbuildings:
Siding Material: Wood
Gas to Structure: Aboveground
Best Access From: Falcon road off of Rowan Road from Hwy 93

Collected By: TNF-E65
Photo 1

Collected Date/Time: 07/29/2017 16:26:01
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16440 Penny Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.83544
GPS Location, Long. 114 4.99674
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: Septic Tank
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: One patrolling engine
Collected By: COCO 482
Photo 1

Where is Safety Zone: Penny Ln to Rowan Rd down to highway 93

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Highway 93 to Rowan Rd to penny Ln

Collected Date/Time: 07/29/2017 16:27:39

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16450 Folsom road
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.04928
GPS Location, Long. 114 6.20892

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Terrain, Fuels, HazMat

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources: None
Needed to Protect:
Notes: Good defensive space,

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected By: Lolo 632

Collected Date/Time: 07/29/2017 16:29:03

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16465 highland drive
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.80916
GPS Location, Long. 114 5.98794
Safety Zone Present: No **Where is Safety Zone:** Escape route is about a seven minute travel time back to Hwy 93
Type of Structure: Residential **Primary Structures:** **Outbuildings:**
Surrounding Fuels: Grass **Defensible Space:** None
Structure Triage Category: Non-Defensible, Prep and Leave
Roof Material: Composite **Siding Material:** Wood
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground **Gas to Structure:** Aboveground
Hazards: Terrain, Fuels
Access to Site: T6 Engine **Best Access From:** highland drive
Comm with ICP: Radio, Cell Service
Water Source:
Mitigation Time: 4-5 Hours
Other Resources Needed to Protect: Hand crew...weed eaters and chain saws
Notes: This is an unoccupied structure.

Collected By: E-27 Florence
Photo 1

Collected Date/Time: 07/29/2017 16:29:16
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16476 Penny Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.78594
GPS Location, Long. 114 4.98582
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: T6 patrol
Collected By: COCO 482
Photo 1

Where is Safety Zone: In driveway... short grass lawn

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: HWY 93 to Rowan Road to Penny Lane

Collected Date/Time: 07/29/2017 16:26:33
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16485 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.08816
GPS Location, Long. 114 6.30204

Escape route: Out to Hwy 93. Travel time 15 minutes
 Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Fuels, HazMat

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Other Resources Needed to Protect: Could benefit from hose lay with sprinklers
Notes: Trees have been limbed on property, pump house up draw half mile to north of house, livestock on property

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected By: Lolo 632

Photo 1

Collected Date/Time: 07/29/2017 16:27:31

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16490 Dundee Road
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.81636
GPS Location, Long. 114 5.57856
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Animals, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: E 632

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures:

Outbuildings:

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to (L) on Dundee, Sandy Ln.

Collected Date/Time: 07/29/2017 16:26:05

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16490 Folsom RD
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.1643
GPS Location, Long. 114 6.22824
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: HazMat

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the

Best Access From: top.

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: E 632

Collected Date/Time: 07/29/2017 16:28:39

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16495 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat: 46 43.22046
GPS Location, Long: 114 6.30948

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: HazMat

Where is Safety Zone: No safety zone on premises

Primary Structures: Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Masonry

Gas to Structure: Aboveground

Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose, Large Pond
Mitigation Time: None Needed
Notes: Livestock on property

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected By: Lolo 632

Collected Date/Time: 07/29/2017 16:28:34

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16495 Folsom Road
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.18788
GPS Location, Long. 114 6.28278

Escape route: Out to Hwy 93. Travel time 15 minutes
 Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub, Timber
Structure Triage Category: Non-Defensible, Prep and Leave
Roof Material: Wood
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Terrain, Fuels, No Turn Around, HazMat

Where is Safety Zone: No safety zone on premises
Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Other Resources Needed to Protect: None
Notes: Light thinning around home, clearing away items from bottom of treehouse

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected By: Lolo 632
 Photo 1

Collected Date/Time: 07/29/2017 16:26:37
 Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16530 Queen Anne's Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.77148
GPS Location, Long. 114 5.2737
Safety Zone Present: Yes **Where is Safety Zone:** Well kept lawn to the east
Type of Structure: Residential **Primary Structures:** **Outbuildings:**
Surrounding Fuels: Grass **Defensible Space:** 30-50 Feet
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite **Siding Material:** Wood
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground **Gas to Structure:** Aboveground
Hazards: Septic Tank
Access to Site: T3/4 Engine **Best Access From:** Rowan Rd
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Notes: Limited turn around beyond this address to the south, with Queen Anne's Ln being a dead end. A type one would be able to fit in the driveway

Collected By: E-27 Florence
Photo 1

Collected Date/Time: 07/29/2017 16:28:10
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16535 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.29804
GPS Location, Long. 114 6.22938
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Terrain, Animals, HazMat

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: None

Best Access From: top.
Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the

Notes: Move debris away from garage. 6000 gallon tank at 16495 can be used for suppression purposes.

Collected By: E 632

Collected Date/Time: 07/29/2017 16:26:09

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16545 Dundee Drive
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.73608
GPS Location, Long. 114 5.69202

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Notes: Wood pile out back near shed could be moved to reduce fuels near structure

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, end of Dundee south

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:27:37
Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16545 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.32834
GPS Location, Long. 114 6.39456
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Fuels, HazMat

Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Collected By: E 632

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to (L) on Dundee, (R) Sandy Ln, (L) Folsom Rd To the top.

Collected Date/Time: 07/29/2017 16:27:30

Photo 2

Photo 1



Photo 4

Photo 3



Structure Triage Information



Structure Number:
Structure Name: 16560 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.25142
GPS Location, Long. 114 6.4587

Escape route: Out to Hwy 93. Travel time 15 minutes
Zone: between Highland and Dundee 10 minutes.

Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Non-Defensible, Prep and Leave
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Terrain

Where is Safety Zone: No safety zone on premises

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: None

Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Other Resources Needed to Protect: hose, sprinklers
Collected By: Lolo 632

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Collected Date/Time: 07/29/2017 16:28:28

Photo 1

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16575 Folsom Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.218
GPS Location, Long. 114 6.49506

Escape route: Out to Hwy 93. Travel time 15 minutes
 Zone: between Highland and Dundee 10 minutes. Safety

Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub, Timber
Structure Triage Category: Non-Defensible, Prep and Leave
Roof Material: Composite
Heat Traps: Wood Deck, Other Receptor
Electrical Power:
Hazards: Terrain, Fuels, Septic Tank

Where is Safety Zone: No safety zone on premises

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure:

Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 2-3 Hours
Other Resources Needed to Protect: Sprinklers would be effective for structures.

Best Access From: Off Hwy 93 to Rowan Rd, head south to Sandy Ln, then head east to highland drive. Right on highland and then a left on Folsom

Notes: Concrete building with 6000 gallon water tank down to the south that feeds four houses. An additional 500 gallons of water in pump house at this structure. Emergency use only. Contact home owners for use. Cell # (406) 880-0419 Larry Ernst. (406) 531-4684

Collected By: Lolo 632

Collected Date/Time: 07/29/2017 16:25:36

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16595 highland drive
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.75594
GPS Location, Long. 114 5.93238
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Timber
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Metal
Heat Traps:
Electrical Power: Underground
Hazards:
Access to Site: T3/4 Engine
Comm with ICP: Radio,Cell Service
Water Source:
Mitigation Time: 2-3 Hours
Collected By: E-27 Florence

Where is Safety Zone: Escape route is seven minutes back to Hwy 93

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure:

Best Access From: Highland drive

Collected Date/Time: 07/29/2017 16:26:32

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16620 Queen Anne
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.71478
GPS Location, Long. 114 5.27292
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank

Where is Safety Zone: Behind structure on east side...large green short grass yard

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Will take a few times to turn a type 3 around in shared driveway...Queen

Best Access From: Anne is best access

Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Collected By: E-27 Florence

Collected Date/Time: 07/29/2017 16:28:27

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16620 Queen Anne's Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.74076
GPS Location, Long. 114 5.27184
Safety Zone Present: Yes **Where is Safety Zone:** South side
Type of Structure: Residential **Primary Structures:** **Outbuildings:**
Surrounding Fuels: Grass **Defensible Space:** >100 Feet
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite **Siding Material:** Wood
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground **Gas to Structure:** Aboveground
Hazards: No Turn Around,Septic Tank
Access to Site: T3/4 Engine **Best Access From:** Rowan Rd
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Notes: Queen Anne's lane is a dead end, one way in, one way out. This residence is the second to last on the east side

Collected By: E-27 Florence
Photo 1

Collected Date/Time: 07/29/2017 16:26:23
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16625 Highland Dr
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.72552
GPS Location, Long. 114 5.96526
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Fuels
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 2-3 Hours
Collected By: E-27 Florence

Where is Safety Zone: 5-8 minutes back down to Hwy 93

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure:

Best Access From: Rowan RD

Collected Date/Time: 07/29/2017 16:28:17

Photo 1

Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16650 highland drive
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.72612
GPS Location, Long. 114 5.84076
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Fuels, Septic Tank
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: 12 gpm well pump for sprinklers...easy water tender delivery...
Collected By: E-27 Florence
Photo 1

Where is Safety Zone: Escape route to hwy 93 about seven minutes...

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Highland drive

Collected Date/Time: 07/29/2017 16:28:12

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16725 Lamar Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.6747
GPS Location, Long. 114 4.98588
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank,HazMat
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane to Lamar Lane

Collected Date/Time: 07/29/2017 16:27:20

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16726 Lamar Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.69168
GPS Location, Long. 114 5.00094
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane to Lamar Lane

Collected Date/Time: 07/29/2017 16:25:54

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16745 Queen Anne's Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.77718
GPS Location, Long. 114 5.34366
Safety Zone Present: Yes **Where is Safety Zone:** -50ft E of the house.
Type of Structure: Residential **Primary Structures:** **Defensible Space:** None
Surrounding Fuels: Grass,Shrub,Timber
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite **Siding Material:** Vinyl
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground **Gas to Structure:**
Hazards: Fuels
Access to Site: T1 Engine **Best Access From:** Queen Anne's Lane
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose,Creek
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: -1 engine crew, tree mitigation needed.
Notes: -Faucet on E side of house.
-Faucet on S side of house.
-Built in sprinkler system around house.
-Faucet 30ft NW of house.

Collected By:

E-56

Collected Date/Time: 07/29/2017 16:26:35

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16755 Queen Anne's Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.72252
GPS Location, Long. 114 5.39526

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Bridge Load Limits
Access to Site: Handcrew
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose, Creek
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: -1 engine crew to take down line of against house.

Where is Safety Zone: -100ft E of house.
-150ft W of house.

Primary Structures: Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Underground

Best Access From: Queen Anne's Lane

Notes:
-Faucet 25ft W of house.
-Faucet on the N side of the house.
-Creek 250ft E of house.

Collected By: E-56

Collected Date/Time: 07/29/2017 16:28:01

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 16781 Lamar Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.64806
GPS Location, Long. 114 4.98912
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass

Where is Safety Zone: Open field directly south of home.

Primary Structures:
Outbuildings:
Defensible Space: 50-100 Feet

Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None

Siding Material: Wood

Gas to Structure:

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane to Lamar Lane

Notes: Above ground pool next to home

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:28:12
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 16797 Lamar Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.64566
GPS Location, Long. 114 5.05746
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: None
Notes: Above ground Pool next to home

Where is Safety Zone: Open field directly south of home.

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane to Lamar Lane

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:26:55
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 17000 McClain Creek Road
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.35364
GPS Location, Long. 114 4.71954
Safety Zone Present: Yes **Where is Safety Zone:** Roads field and parking area surrounding the home
Type of Structure: Residential **Primary Structures:** **Outbuildings:**
Surrounding Fuels: Grass, Shrub **Defensible Space:** 30-50 Feet
Structure Triage Category: Defensible, Stand Alone
Roof Material: Metal **Siding Material:** Metal
Heat Traps: Open Eaves
Electrical Power: Underground **Gas to Structure:** Aboveground
Hazards: Fuels, Septic Tank, HazMat
Access to Site: T1 Engine **Best Access From:** Off old Highway 93
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: One engine crew to remove debris that is next to the home
Notes: The home is surrounded by a road system to the west, north, and the south of the home

Collected By: E-56

Photo 1

Collected Date/Time: 07/29/2017 16:28:21

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 17020 old highway 93
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.35064
GPS Location, Long. 114 4.72218
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub

Where is Safety Zone: Road area to the east of the house

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Open Eaves, Wood Deck
Electrical Power: Overhead
Hazards: Fuels
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: One engine crew set up sprinklers to prevent grass from burning up to structure

Siding Material: Wood

Gas to Structure: Underground

Best Access From: Old Highway 93

Notes: Multiple roads and fuel brakes surrounding the east, south, and west of the home. There are five mailboxes in the area with only three structures that are livable

Collected By: COCO 482
Photo 1

Collected Date/Time: 07/29/2017 16:26:25
Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 5815 Rowan Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.88404
GPS Location, Long. 114 4.78992

Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: One type 3 engine with 6 people to patrol property

Where is Safety Zone: Safety zone large fields around house Escape route Rowan Rd to highway 93

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Highway 93 to Rowan Rd

Notes: 10 horse sheds around property, 1 Large barn on property, outside structures have metal roofs. There is a lot of horses on the property

Collected By: COCO 482
Photo 1

Collected Date/Time: 07/29/2017 16:26:44
Photo 2



Photo 1



Photo 2



Photo 3

Structure Triage Information



Structure Number:
Structure Name: 5827 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.70626
GPS Location, Long. 114 4.6878
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:26:50

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 5835 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.71418
GPS Location, Long. 114 4.70622
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards: Fuels, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:25:20

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 5892 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.73128
GPS Location, Long. 114 4.75434

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material:
Heat Traps:
Electrical Power:
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Notes: Self storage buildings.

Where is Safety Zone: Escape route: Out to Hwy 93. Travel time 5 minutes Safety
Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures: **Outbuildings:**
Defensible Space: >100 Feet
Siding Material:
Gas to Structure:
Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:29:16
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 5893 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.71064
GPS Location, Long. 114 4.77516
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:28:32

Photo 1

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 5960 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.73434
GPS Location, Long. 114 4.80936

Escape route: Out to Hwy 93. Travel time 5 minutes Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards: Animals, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources: None
Needed to Protect:
Notes: None.

Where is Safety Zone: Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures: Defensible Space: >100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:26:14
Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 5981 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.7077
GPS Location, Long. 114 4.77954
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:26:12

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6020 Crist Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.81432
GPS Location, Long. 114 4.91046
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Metal
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Septic Tank
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: Engine crew.
Collected By: COCO 482

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93.

Primary Structures:

Outbuildings:

Defensible Space: 30-50 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan to Christ.

Collected Date/Time: 07/29/2017 16:26:28

Photo 1

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6025 Crist lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.77682
GPS Location, Long. 114 4.94934
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass

Where is Safety Zone: Large field adjacent to the property

Primary Structures:
Defensible Space: 50-100 Feet

Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Other Receptor
Electrical Power: Underground

Siding Material: Vinyl

Gas to Structure: Aboveground

Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: 1 engine to Patrol

Best Access From: Highway 93, Rowan Road, Penny Lane, Crist Lane.

Notes: Propane tank in front of house small wood pile under driveway.

Collected By: COCO 482
Photo 1

Collected Date/Time: 07/29/2017 16:26:18
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6025 Rowan Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.90582
GPS Location, Long. 114 4.9146
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: Possible sprinkler system.
Collected By: TNF-65

Where is Safety Zone: Large field in front of home

Primary Structures:

Outbuildings:

Defensible Space: >100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Rowan Rd

Collected Date/Time: 07/29/2017 16:28:37

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6044 Crist Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.83976
GPS Location, Long. 114 4.93128
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: One engine to patrol
Collected By: COCO 482
Photo 1

Where is Safety Zone: Open fields

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Crist Ln to Rowan Rd to highway 93

Collected Date/Time: 07/29/2017 16:29:22
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6048 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.73584
GPS Location, Long. 114 4.90488

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Escape route: Out to Hwy 93. Travel time 5 minutes Safety
Where is Safety Zone: Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures: Outbuildings:

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected Date/Time: 07/29/2017 16:26:21
Photo 2

Photo 1



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6049 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.72522
GPS Location, Long. 114 4.89474
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:25:52

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6096 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.71562
GPS Location, Long. 114 4.94442

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Where is Safety Zone: Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures:

Defensible Space: >100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected Date/Time: 07/29/2017 16:29:20

Photo 1



Photo 3



Photo 2



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6105 Rowan Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.89652
GPS Location, Long. 114 4.9662
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Notes: None

Where is Safety Zone: Yard and fields surrounding structure.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Rowan Rd off of hwy 93.

Collected By: TNF-E65
Photo 1

Collected Date/Time: 07/29/2017 16:28:46
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6125 Crist Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.7872
GPS Location, Long. 114 4.98852
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Fuels
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: T6 patrol
Collected By: COCO 482
Photo 1

Where is Safety Zone: Take Penny Lane to Rowan Road to HWY 93

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: HWY 93 to Rowan Road to Penny Lane to Crist Ln

Collected Date/Time: 07/29/2017 16:28:51
Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6205 Rowan Dr
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.90726
GPS Location, Long. 114 5.06322
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Collected By: E-27 Florence

Where is Safety Zone: Across fence on west side in neighbors yard

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Rowan road..

Collected Date/Time: 07/29/2017 16:26:21

Photo 1

Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6220 Crist Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.79806
GPS Location, Long. 114 5.07714
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Fuels
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose, Porta-Tank/Pumpkin
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: Pool in backyard could be used as a pumpkin
Collected By: TNF-65

Where is Safety Zone: Open space surrounding houses.

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: Aboveground

Best Access From: Rowan Rd

Collected Date/Time: 07/29/2017 16:25:43

Photo 1



Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6225 Christ Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.78186
GPS Location, Long. 114 5.08512
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources: None
Needed to Protect:
Notes: None

Where is Safety Zone: Field on east side of structure. Access through gate off of Christ lane.

Primary Structures:

Outbuildings:

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Christ Lane off of Falcon Road. Also off Penny Lane.

Collected By: TNF-E65

Photo 1

Collected Date/Time: 07/29/2017 16:27:44

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6230 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.7404
GPS Location, Long. 114 5.04336

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Where is Safety Zone: Zone: multiple fields that could be used as safety zones in immediate area. Safety

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Masonry

Gas to Structure: Aboveground

Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected Date/Time: 07/29/2017 16:25:45
Photo 2



Photo 1



Photo 2

Structure Triage Information



Structure Number:
Structure Name: 6235 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.6867
GPS Location, Long. 114 5.04294
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck,Rain Gutters
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio,Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:27:05

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6283 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.74262
GPS Location, Long. 114 5.05008

Escape route: Out to Hwy 93. Travel time 5 minutes Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None

Where is Safety Zone: Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures: Outbuildings:

Defensible Space: >100 Feet

Siding Material: Vinyl

Gas to Structure:

Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected By: Lolo 632

Collected Date/Time: 07/29/2017 16:25:23

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6308 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.70518
GPS Location, Long. 114 5.1129

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None
Notes: Currently unoccupied.

Where is Safety Zone: Escape route: Out to Hwy 93. Travel time 5 minutes Safety
Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures:
Outbuildings:
Defensible Space: >100 Feet
Siding Material: Vinyl
Gas to Structure: None
Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:28:19
Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6325 Christ Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.77196
GPS Location, Long. 114 5.16012
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Timber

Where is Safety Zone: Yard and fields surrounding structure.

Primary Structures:
Defensible Space: >100 Feet
Outbuildings:

Structure Triage Category: Defensible, Prep and Hold
Roof Material: Metal
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Animals, Septic Tank, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: None

Siding Material: Wood
Gas to Structure: Aboveground

Best Access From: Christ road from Falcon road

Notes: Owner has lawn sprinklers in yard. LPG tank has tall grass touching tank and would need prepped.

Collected By: TNF-E65
Photo 1

Collected Date/Time: 07/29/2017 16:28:49
Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6326 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.72522
GPS Location, Long. 114 5.13798

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Animals, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None.
Notes: None

Where is Safety Zone: Escape route: Out to Hwy 93. Travel time 5 minutes Safety
Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Masonry

Gas to Structure: None

Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected By: Lolo 632

Photo 1

Collected Date/Time: 07/29/2017 16:27:17

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6350 Maiden Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.1001
GPS Location, Long. 114 5.16282
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps:
Electrical Power: Underground
Hazards: Septic Tank
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: One engine to patrol
Collected By: COCO 482

Where is Safety Zone: Open field

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Maiden lane to Rowan road to highway 93

Collected Date/Time: 07/29/2017 16:25:31

Photo 1

Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6364 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.72396
GPS Location, Long. 114 5.1426

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Shrub, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards: HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Other Resources Needed to Protect: None.
Notes: None.

Where is Safety Zone: Escape route: Out to Hwy 93. Travel time 5 minutes Safety
Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: None

Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:29:05
Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6365 Ray Lane
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.67044
GPS Location, Long. 114 5.16744
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass

Where is Safety Zone: Open field directly south of home.

Primary Structures:
Outbuildings:
Defensible Space: 50-100 Feet

Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards: Septic Tank, HazMat
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: 1-2 Hours
Other Resources Needed to Protect: None

Siding Material: Wood

Gas to Structure: None

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Notes: Some time needed to move firewood away from outbuilding, vents near roof could trap embers

Collected By: Lolo 632
Photo 1

Collected Date/Time: 07/29/2017 16:25:48
Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6407 McClaine Creek Road
SubDivision: Macintosh Manor
GPS Location, Lat. 46 41.76192
GPS Location, Long. 114 5.23506
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards: Fuels, Septic Tank
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Notes:
-Small pond 25ft NE of house.
-Faucet on N side of building.

Where is Safety Zone: Present on all sides of the house.

Primary Structures:

Outbuildings:

Defensible Space: >100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: McClaine Creek Road

Collected By: E-56

Photo 1

Collected Date/Time: 07/29/2017 16:25:26

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6470 Maiden Ln
SubDivision: Macintosh Manor
GPS Location, Lat. 46 43.10436
GPS Location, Long. 114 5.259

Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards: Fuels
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: One patrolling engine
Collected By: COCO 482

Where is Safety Zone: Multiple open fields between Highlands Rd and Hwy 93. Escape route maiden Ln to Queen Anne down Rowan Rd to highway 93

Primary Structures:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Hwy 93 to Rowan Rd to Queen Anne

Collected Date/Time: 07/29/2017 16:25:50

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6659 Lamar Trail.
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.65148
GPS Location, Long. 114 5.41038
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: Underground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:27:26

Photo 1



Photo 3



Photo 2



Photo 4

Structure Triage Information



Structure Number: 6720
Structure Name: Macintosh Manor
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.93138
GPS Location, Long. 114 5.48376

Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass, Timber
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Other Resources Needed to Protect: One patrolling engine
Collected By: COCO 482

Where is Safety Zone: Not viable in worst fire scenario. Safety zone: Escape route: down Rowan Rd to highway 93

Primary Structures: Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Highway 93 to Rowan Rd

Collected Date/Time: 07/29/2017 16:27:33

Photo 1

Photo 2



Photo 3



Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6818 Rowan Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.90972
GPS Location, Long. 114 5.56104
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Collected By: E-27 Florence

Where is Safety Zone: Safety zone is in yard
Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure:

Best Access From: Rowan Rd

Collected Date/Time: 07/29/2017 16:28:30
Photo 2



Photo 1

Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 6853 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.6903
GPS Location, Long. 114 5.57628
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters, Other Receptor
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Vinyl

Gas to Structure: Underground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:26:07

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6899 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.63684
GPS Location, Long. 114 5.63238
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: Underground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:28:56

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 6955 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.60798
GPS Location, Long. 114 5.68656
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures:

Outbuildings:

Defensible Space: 50-100 Feet

Siding Material: Vinyl

Gas to Structure: Underground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:28:03

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 7023 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.5907
GPS Location, Long. 114 5.75316
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels:
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Vinyl

Gas to Structure: Underground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:28:53

Photo 1

Photo 2



Photo 3

Photo 4



Structure Triage Information



Structure Number:
Structure Name: 7160 Rowan Rd
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.95682
GPS Location, Long. 114 5.73168
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Metal
Heat Traps: Open Eaves, Wood Deck, Rain Gutters
Electrical Power: Underground
Hazards:
Access to Site: T3/4 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: Less Than An Hour
Collected By: E-27 Florence

Where is Safety Zone: Escape route three minutes to Hwy 93

Primary Structures: **Outbuildings:**

Defensible Space: 50-100 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Rowan Rd.

Collected Date/Time: 07/29/2017 16:25:26

Photo 1

Photo 2



Photo 3

Photo 4

Structure Triage Information



Structure Number:
Structure Name: 7181 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.55584
GPS Location, Long. 114 5.84406
Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub
Structure Triage Category: Defensible, Stand Alone
Roof Material: Composite
Heat Traps: Other Receptor
Electrical Power: Underground
Hazards:
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source: Faucet / Hose
Mitigation Time: None Needed
Collected By: Lolo 632

Where is Safety Zone: Open field directly south of home.

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Vinyl

Gas to Structure: Underground

Best Access From: Hwy 93 to Rowan to Old Hwy 93 to Ray Lane

Collected Date/Time: 07/29/2017 16:28:14

Photo 1

Photo 2



Photo 3



Photo 4



Structure Triage Information



Structure Number:
Structure Name: 8337 Lamar Trail
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.10194
GPS Location, Long. 114 6.86406

Escape route: Out to Hwy 93. Travel time 5 minutes Safety

Safety Zone Present: Yes
Type of Structure: Residential
Surrounding Fuels: Grass, Shrub, Timber

Where is Safety Zone: Zone: multiple fields that could be used as safety zones in immediate area.

Primary Structures: **Outbuildings:**

Defensible Space: >100 Feet

Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite

Siding Material: Wood

Heat Traps: Wood Deck, Rain Gutters

Gas to Structure: None

Electrical Power: Underground

Hazards: Fuels, No Turn Around, HazMat

Best Access From: Off Hwy 93 to Old Hwy 93 to Ray Ln all the way to end of road.

Access to Site: T3/4 Engine

Comm with ICP: Radio, Cell Service

Water Source: Faucet / Hose

Mitigation Time: 2-3 Hours

Other Resources Needed to Protect: 1 saw team.

Collected By: Lolo 632

Collected Date/Time: 07/29/2017 16:25:05


Photo 1

Photo 2



Photo 3

Photo 4

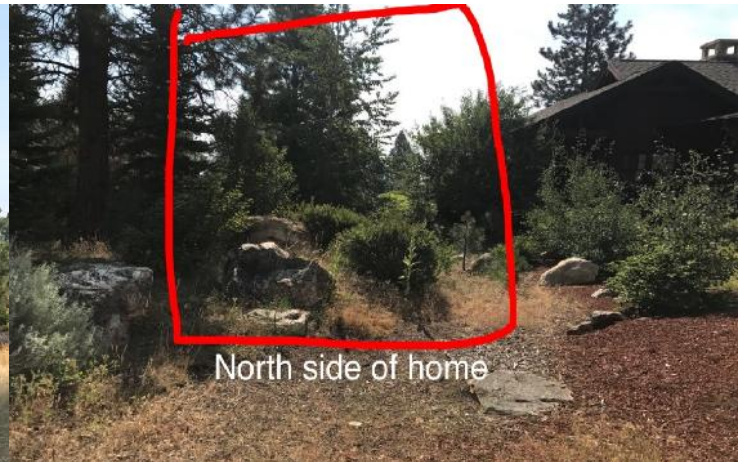

Structure Triage Information



Structure Number:
Structure Name: ???? Highland drive
SubDivision: Macintosh Manor
GPS Location, Lat. 46 42.75636
GPS Location, Long. 114 5.90184
Safety Zone Present: No
Type of Structure: Residential
Surrounding Fuels: Grass
Structure Triage Category: Defensible, Prep and Hold
Roof Material: Composite
Heat Traps: Open Eaves, Wood Deck
Electrical Power: Underground
Hazards: Fuels
Access to Site: T1 Engine
Comm with ICP: Radio, Cell Service
Water Source:
Mitigation Time: Less Than An Hour
Collected By: E-27 Florence

Where is Safety Zone: About a seven minute drive for escape route back to Hwy 93

Primary Structures: **Outbuildings:**

Defensible Space: 30-50 Feet

Siding Material: Wood

Gas to Structure: Aboveground

Best Access From: Highland drive

Collected Date/Time: 07/29/2017 16:28:18

Photo 1

Photo 2



Photo 3

Photo 4

